



Englefield Reserve Toilet
Qualitative Engineering Evaluation

Reference: 229172
Prepared for:
Christchurch City Council

Functional Location ID: PRK 0362 BLDG 001

Address: 65 Englefield Road

Revision: 2

Date: 4 July 2013

Document Control Record

Document prepared by:

Aurecon New Zealand Limited
 Level 2, 518 Colombo Street
 Christchurch 8011
 PO Box 1061
 Christchurch 8140
 New Zealand

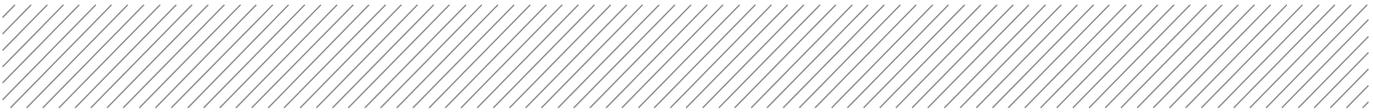
T +64 3 366 0821
F +64 3 379 6955
E christchurch@aurecongroup.com
W aurecongroup.com

A person using Aurecon documents or data accepts the risk of:

- Using the documents or data in electronic form without requesting and checking them for accuracy against the original hard copy version.
- Using the documents or data for any purpose not agreed to in writing by Aurecon.

| Document control | | | | aurecon | | |
|-------------------------------|-------------|---|-----------------------|---------------|-------------------|-----------------|
| Report Title | | Qualitative Engineering Evaluation | | | | |
| Functional Location ID | | PRK 0362 BLDG 001 | Project Number | | 229172 | |
| File Path | | P:\ 229172 - Englefield Reserve Toilet.docx | | | | |
| Client | | Christchurch City Council | Client Contact | | Michael Sheffield | |
| Rev | Date | Revision Details/Status | Prepared | Author | Verifier | Approver |
| 1 | 2 July 2012 | Draft | L. Castillo | L. Castillo | L. Howard | L. Howard |
| 2 | 4 July 2013 | Final | L. Castillo | L. Castillo | L. Howard | L. Howard |
| Current Revision | | 2 | | | | |

| Approval | | | | | |
|------------------|--|---|--------------------|--|---|
| Author Signature | |  | Approver Signature | |  |
| Name | | Steven Waldrip | Name | | Lee Howard |
| Title | | Structural Engineer | Title | | Senior Structural Engineer |



Contents

| | |
|---|----------|
| Executive Summary | 1 |
| 1 Introduction | 2 |
| 1.1 General | 2 |
| 2 Description of the Building | 2 |
| 2.1 Building Age and Configuration | 2 |
| 2.2 Building Structural Systems Vertical and Horizontal | 2 |
| 2.3 Reference Building Type | 3 |
| 2.4 Building Foundation System and Soil Conditions | 3 |
| 2.5 Available Structural Documentation and Inspection Priorities | 3 |
| 2.6 Available Survey Information | 3 |
| 3 Structural Investigation | 3 |
| 3.1 Summary of Building Damage | 3 |
| 3.2 Record of Intrusive Investigation | 3 |
| 3.3 Damage Discussion | 3 |
| 4 Building Review Summary | 4 |
| 4.1 Building Review Statement | 4 |
| 4.2 Critical Structural Weaknesses | 4 |
| 5 Building Strength (Refer to Appendix C for background information) | 4 |
| 5.1 General | 4 |
| 5.2 Initial %NBS Assessment | 4 |
| 5.3 Results Discussion | 5 |
| 6 Conclusions and Recommendations | 5 |
| 7 Explanatory Statement | 6 |

Appendices

Appendix A Site Map and Photos

Appendix B References

Appendix C Strength Assessment Explanation

Appendix D Background and Legal Framework

Appendix E Standard Reporting Spread Sheet

Executive Summary

This is a summary of the Qualitative Engineering Evaluation for the Englefield Reserve Toilet building and is based on the Detailed Engineering Evaluation Procedure document issued by the Engineering Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

| | | | | | |
|--|--|---|---|-------------------------------|------|
| Building Details | Name | Englefield Reserve Toilet | | | |
| Building Location ID | PRK 0362 BLDG 001 | Multiple Building Site | Y | | |
| Building Address | 65 Englefield Road | No. of residential units | 0 | | |
| Soil Technical Category | N/A | Importance Level | 1 | Approximate Year Built | 2003 |
| Foot Print (m²) | 6 | Stories above ground | 1 | Stories below ground | 0 |
| Type of Construction | Light corrugated metal roof supported on a timber truss, light timber framed walls, concrete strip foundation and concrete slab floor. | | | | |
| Qualitative L4 Report Results Summary | | | | | |
| Building Occupied | Y | The Englefield Reserve Toilet is currently in use. | | | |
| Suitable for Continued Occupancy | Y | The Englefield Reserve Toilet is suitable for continued occupation. | | | |
| Key Damage Summary | Y | Refer to summary of building damage Section 3.1 report body. | | | |
| Critical Structural Weaknesses (CSW) | N | No critical structural weaknesses were identified. | | | |
| Levels Survey Results | N | Level survey is not required for this structure. | | | |
| Building %NBS From Analysis | >100% | Based on an analysis of bracing capacity and demand. | | | |
| Qualitative L4 Report Recommendations | | | | | |
| Geotechnical Survey Required | N | Geotechnical survey not required due to lack of observed ground damage on site. | | | |
| Proceed to L5 Quantitative DEE | N | A DEE quantitative report is not required. It is recommended that this document is considered the final report. | | | |
| Approval | | | | | |
| Author Signature |  | Approver Signature |  | | |
| Name | Steven Waldrip | Name | Lee Howard | | |
| Title | Structural Engineer | Title | Senior Structural Engineer | | |



1 Introduction

1.1 General

On 29 May 2012 Aurecon engineers visited the Englefield Reserve Toilet to carry out a qualitative building damage assessment on behalf of Christchurch City Council. Detailed visual inspections were carried out to assess the damage caused by the earthquakes on 4 September 2010, 22 February 2011, 13 June 2011, 23 December 2011 and related aftershocks.

The scope of work included:

- Assessment of the nature and extent of the building damage.
- Visual assessment of the building strength particularly with respect to safety of occupants if the building is currently occupied.
- Assessment of requirements for detailed engineering evaluation including geotechnical investigation, level survey and any areas where linings and floor coverings need removal to expose structural damage.

This report outlines the results of our Qualitative Assessment of damage to the Englefield Reserve Toilet and is based on the Detailed Engineering Evaluation Procedure document issued by the Structural Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

2 Description of the Building

2.1 Building Age and Configuration

Built in/around 2003 the Englefield Reserve Toilet is a single storey toilet block. The structure of the exterior walls is composed of timber studs and dwangs and has a wall brace installed on the lateral elevations of the building. The finishing of the walls is 9mm hardiflex with 25x75mm battens on the external surface and 9mm villa board on the inner surface. The roof, which consists of corrugated steel sheeting, is supported by timber trusses in a radial configuration.

The floor is 100mm thick concrete slab with 200mm wide strip foundations around the perimeter of the structure founded 350mm below the base of the slab. The approximate floor area of the building is 6 m². It is an importance level 1 structure in accordance with NZS 1170 Part 0:2002.

2.2 Building Structural Systems Vertical and Horizontal

The Englefield Reserve Toilet is a very simple structure. Its light corrugated roof is supported on timber trusses that transfer loads to timber studs within the walls. Lateral loads are resisted by lined timber framed walls located on the perimeter of the structure. Internally the walls and ceiling are lined with villa board. Externally the walls are clad with hardiflex with timber battens.



2.3 Reference Building Type

The Englefield Reserve Toilet is a basic toilet block typical of its age and style. It should have been subjected to simple engineering design and constructed to a reliable formula known to achieve the performance and aesthetic objectives at the time it was built.

2.4 Building Foundation System and Soil Conditions

The Englefield Reserve Toilet has a concrete floor slab on grade with shallow strip foundations around its perimeter. The land surrounding Englefield Reserve Toilet to the east/north is zoned TC2 and TC3 to the west/south which means, respectively, that minor to moderate and moderate to significant damage from liquefaction is possible in future significant earthquakes. However, there were no signs in the vicinity of liquefaction bulges, boils or subsidence.

2.5 Available Structural Documentation and Inspection Priorities

At the time of this assessment the structural drawings were available allowing us have a clear idea of the technical aspects needed for the present evaluation. The inspection priorities are related to a review of potential damage to foundations, consideration of wall bracing adequacy of the structural systems.

2.6 Available Survey Information

Given the lack of ground damage/movement noted in the surrounding area and our observations during our inspection a level survey is not required for this structure.

3 Structural Investigation

3.1 Summary of Building Damage

The Englefield Reserve Toilet was in use at the time the damage assessment was carried out.

The Englefield Reserve Toilet has performed well and does not present significant structural damage by the time the assessment was done.

3.2 Record of Intrusive Investigation

Given there is not noticeable overall damage and all of the structure could be sighted, an intrusive investigation was neither warranted nor undertaken for Englefield Reserve Toilet.

3.3 Damage Discussion

There was no damage observed to the Englefield Reserve Toilet as a result of seismic actions.

4 Building Review Summary

4.1 Building Review Statement

As noted above no intrusive investigations were carried out for the Englefield Reserve Toilet. Because of the generic nature of the building a significant amount of information can be inferred from an external and internal inspection.

4.2 Critical Structural Weaknesses

No specific critical structural weaknesses were identified as part of the building qualitative assessment.

5 Building Strength (Refer to Appendix C for background information)

5.1 General

The Englefield Reserve Toilet is, as discussed above, a typical example of an early 2000's toilet block built from lined timber framed walls and timber truss roof. It is of a type of building that, due to its light weight roof and flexible walls, has typically performed well.

5.2 Initial %NBS Assessment

The Englefield Reserve Toilet has not been subject to specific engineering design and the initial evaluation procedure or IEP is not an appropriate method of assessment for this building. Nevertheless an estimate of lateral load capacity can be made by adopting assumed values for strengths of existing materials and calculating the capacity of existing walls.

Selected assessment seismic parameters are tabulated in the Table 1 below.

Table 1: Parameters used in the Seismic Assessment

| Seismic Parameter | Quantity | Comment/Reference |
|---|----------|--|
| Site Soil Class | D | NZS 1170.5:2004, Clause 3.1.3, Deep or Soft Soil |
| Site Hazard Factor, Z | 0.30 | DBH Info Sheet on Seismicity Changes (Effective 19 May 2011) |
| Return period Factor, R_u | 0.50 | NZS 1170.5:2004, Table 3.5 |
| Ductility Factor in Transverse Direction, μ | 3.00 | Lined lightweight timber framed walls |
| Ductility Factor in Longitudinal Direction, μ | 3.00 | Lined lightweight timber framed walls |



The seismic demand for the Englefield Reserve Toilet has been calculated based on the current code requirements of NZS 3604:2011. The capacity of the existing walls in the building was calculated from assumed strengths of existing materials and the number and length of walls present for both the north – south and east – west directions. The seismic demand was then compared with the building capacity in these directions. The building was found to have a sufficient number and length of walls in both the north – south and east – west directions to achieve a capacity greater than 100% NBS.

5.3 Results Discussion

Basic analysis shows that the Englefield Reserve Toilet is capable of achieving seismic performance in line with the current code requirements. This the result from the assessment of a lightweight single story construction like that of Englefield Reserve Toilet that produces a low seismic demand which, when combined with well distributed walls providing seismic resistance, produces a structure with good seismic performance and relatively good torsional stability.

6 Conclusions and Recommendations

As there is no clear evidence of any liquefaction or ground movement in the vicinity of the Englefield Reserve Toilet **a geotechnical investigation is currently not considered necessary.**

The building is currently occupied and in use and in our opinion the Englefield Reserve Toilet **is considered suitable for continued occupation.**



7 Explanatory Statement

The inspections of the building discussed in this report have been undertaken to assess structural earthquake damage. No analysis has been undertaken to assess the strength of the building or to determine whether or not it complies with the relevant building codes, except to the extent that Aurecon expressly indicates otherwise in the report. Aurecon has not made any assessment of structural stability or building safety in connection with future aftershocks or earthquakes – which have the potential to damage the building and to jeopardise the safety of those either inside or adjacent to the building, except to the extent that Aurecon expressly indicates otherwise in the report.

This report is necessarily limited by the restricted ability to carry out inspections due to potential structural instabilities/safety considerations, and the time available to carry out such inspections. The report does not address defects that are not reasonably discoverable on visual inspection, including defects in inaccessible places and latent defects. Where site inspections were made, they were restricted to external inspections and, where practicable, limited internal visual inspections.

To carry out the structural review, existing building drawings were obtained from the Christchurch City Council records. We have assumed that the building has been constructed in accordance with the drawings.

While this report may assist the client in assessing whether the building should be strengthened, that decision is the sole responsibility of the client.

This review has been prepared by Aurecon at the request of its client and is exclusively for the client's use. It is not possible to make a proper assessment of this review without a clear understanding of the terms of engagement under which it has been prepared, including the scope of the instructions and directions given to and the assumptions made by Aurecon. The report will not address issues which would need to be considered for another party if that party's particular circumstances, requirements and experience were known and, further, may make assumptions about matters of which a third party is not aware. No responsibility or liability to any third party is accepted for any loss or damage whatsoever arising out of the use of or reliance on this report by any third party.

Without limiting any of the above, Aurecon's liability, whether under the law of contract, tort, statute, equity or otherwise, is limited as set out in the terms of the engagement with the client.

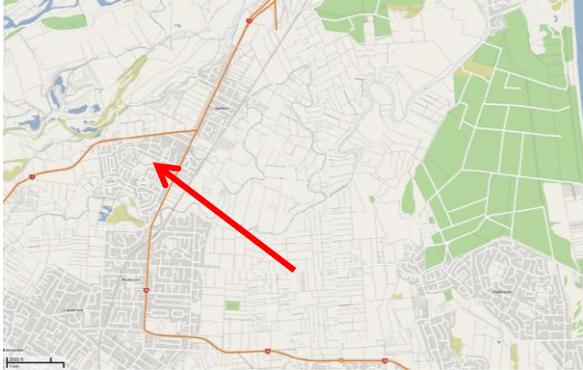
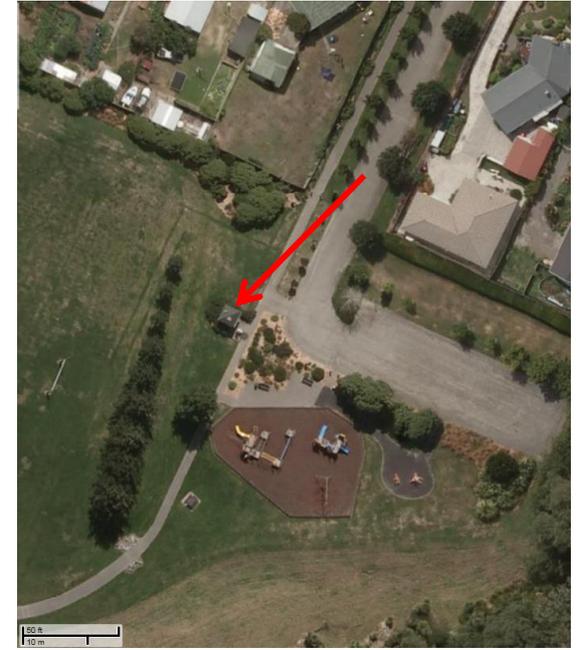
Appendices



Appendix A

Site Map and Photos

29 May 2012 – Englefield Reserve Toilet Site Photographs

| | |
|--|--|
| <p>Location of Englefield Reserve Toilet.</p> |  |
| <p>Aerial photograph of Englefield Reserve Toilet.</p> |  |
| <p>Building northern elevation.</p> |  |

Building western elevation.



Building eastern elevation.



Building internal view.



Internal view of roof.



Appendix B

References

1. Department of Building and Housing (DBH), "Revised Guidance on Repairing and Rebuilding Houses Affected by the Canterbury Earthquake Sequence", November 2011
2. New Zealand Society for Earthquake Engineering (NZSEE), "Assessment and Improvement of the Structural Performance of Buildings in Earthquakes", April 2012
3. Standards New Zealand, "AS/NZS 1170 Part 0, Structural Design Actions: General Principles", 2002
4. Standards New Zealand, "AS/NZS 1170 Part 1, Structural Design Actions: Permanent, imposed and other actions", 2002
5. Standards New Zealand, "NZS 1170 Part 5, Structural Design Actions: Earthquake Actions – New Zealand", 2004
6. Standards New Zealand, "NZS 3101 Part 1, The Design of Concrete Structures", 2006
7. Standards New Zealand, "NZS 3404 Part 1, Steel Structures Standard", 1997
8. Standards New Zealand, "NZS 3606, Timber Structures Standard", 1993
9. Standards New Zealand, "NZS 3604, Timber Framed Structures", 2011
10. Standards New Zealand, "NZS 4229, Concrete Masonry Buildings Not Requiring Specific Engineering Design", 1999
11. Standards New Zealand, "NZS 4230, Design of Reinforced Concrete Masonry Structures", 2004

Appendix C

Strength Assessment Explanation

New building standard (NBS)

New building standard (NBS) is the term used with reference to the earthquake standard that would apply to a new building of similar type and use if the building was designed to meet the latest design Codes of Practice. If the strength of a building is less than this level, then its strength is expressed as a percentage of NBS.

Earthquake Prone Buildings

A building can be considered to be earthquake prone if its strength is less than one third of the strength to which an equivalent new building would be designed, that is, less than 33%NBS (as defined by the New Zealand Building Act). If the building strength exceeds 33%NBS but is less than 67%NBS the building is considered at risk.

Christchurch City Council Earthquake Prone Building Policy 2010

The Christchurch City Council (CCC) already had in place an Earthquake Prone Building Policy (EPB Policy) requiring all earthquake-prone buildings to be strengthened within a timeframe varying from 15 to 30 years. The level to which the buildings were required to be strengthened was 33%NBS.

As a result of the 4 September 2010 Canterbury earthquake the CCC raised the level that a building was required to be strengthened to from 33% to 67% NBS but qualified this as a target level and noted that the actual strengthening level for each building will be determined in conjunction with the owners on a building-by-building basis. Factors that will be taken into account by the Council in determining the strengthening level include the cost of strengthening, the use to which the building is put, the level of danger posed by the building, and the extent of damage and repair involved.

Irrespective of strengthening level, the threshold level that triggers a requirement to strengthen is 33%NBS.

As part of any building consent application fire and disabled access provisions will need to be assessed.

Christchurch Seismicity

The level of seismicity within the current New Zealand loading code (AS/NZS 1170) is related to the seismic zone factor. The zone factor varies depending on the location of the building within NZ. Prior to the 22nd February 2011 earthquake the zone factor for Christchurch was 0.22. Following the earthquake the seismic zone factor (level of seismicity) in the Christchurch and surrounding areas has been increased to 0.3. This is a 36% increase.

For this assessment, the building's earthquake resistance is compared with the current New Zealand Building Code requirements for a new building constructed on the site. This is expressed as a percentage of new building standard (%NBS). The new building standard load requirements have been determined in accordance with the current earthquake loading standard (NZS 1170.5:2004 Structural design actions - Earthquake actions - New Zealand).

The likely capacity of this building has been derived in accordance with the New Zealand Society for Earthquake Engineering (NZSEE) guidelines 'Assessment and Improvement of the Structural Performance of Buildings in Earthquakes' (AISPBE), 2006. These guidelines provide an Initial Evaluation Procedure that assesses a buildings capacity based on a comparison of loading codes from when the building was designed

and currently. It is a quick high-level procedure that can be used when undertaking a Qualitative analysis of a building. The guidelines also provide guidance on calculating a modified Ultimate Limit State capacity of the building which is much more accurate and can be used when undertaking a Quantitative analysis.

The New Zealand Society for Earthquake Engineering has proposed a way for classifying earthquake risk for existing buildings in terms of %NBS and this is shown in Figure C1 below.

| Description | Grade | Risk | %NBS | Existing Building Structural Performance | Improvement of Structural Performance | |
|------------------------|--------|----------|-------------|---|---|---|
| | | | | | Legal Requirement | NZSEE Recommendation |
| Low Risk Building | A or B | Low | Above 67 | Acceptable (improvement may be desirable) | The Building Act sets no required level of structural improvement (unless change in use) This is for each TA to decide. Improvement is not limited to 34%NBS. | 100%NBS desirable. Improvement should achieve at least 67%NBS |
| Moderate Risk Building | B or C | Moderate | 34 to 66 | Acceptable legally. Improvement recommended | | Not recommended. Acceptable only in exceptional circumstances |
| High Risk Building | D or E | High | 33 or lower | Unacceptable (Improvement | Unacceptable | Unacceptable |

Figure C1: NZSEE Risk Classifications Extracted from table 2.2 of the NZSEE 2006 AISPBE Guidelines

Table C1 below compares the percentage NBS to the relative risk of the building failing in a seismic event with a 10% probability of exceedance in 50 years (i.e. 0.2% in the next year). It is noted that the current seismic risk in Christchurch results in a 6% probability of exceedance in the next year.

Table C1: Relative Risk of Building Failure In A

| Percentage of New Building Standard (%NBS) | Relative Risk (Approximate) |
|--|-----------------------------|
| >100 | <1 time |
| 80-100 | 1-2 times |
| 67-80 | 2-5 times |
| 33-67 | 5-10 times |
| 20-33 | 10-25 times |
| <20 | >25 times |

Appendix D

Background and Legal Framework

Background

Aurecon has been engaged by the Christchurch City Council (CCC) to undertake a detailed engineering evaluation of the building

This report is a Qualitative Assessment of the building structure, and is based on the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011.

A qualitative assessment involves inspections of the building and a desktop review of existing structural and geotechnical information, including existing drawings and calculations, if available.

The purpose of the assessment is to determine the likely building performance and damage patterns, to identify any potential critical structural weaknesses or collapse hazards, and to make an initial assessment of the likely building strength in terms of percentage of new building standard (%NBS).

At the time of this report, no intrusive site investigation, detailed analysis, or modelling of the building structure had been carried out. Construction drawings were made available, and these have been considered in our evaluation of the building. The building description below is based on a review of the drawings and our visual inspections.

Compliance

This section contains a brief summary of the requirements of the various statutes and authorities that control activities in relation to buildings in Christchurch at present.

Canterbury Earthquake Recovery Authority (CERA)

CERA was established on 28 March 2011 to take control of the recovery of Christchurch using powers established by the Canterbury Earthquake Recovery Act enacted on 18 April 2011. This act gives the Chief Executive Officer of CERA wide powers in relation to building safety, demolition and repair. Two relevant sections are:

Section 38 – Works

This section outlines a process in which the chief executive can give notice that a building is to be demolished and if the owner does not carry out the demolition, the chief executive can commission the demolition and recover the costs from the owner or by placing a charge on the owners' land.

Section 51 – Requiring Structural Survey

This section enables the chief executive to require a building owner, insurer or mortgagee carry out a full structural survey before the building is re-occupied.

We understand that CERA will require a detailed engineering evaluation to be carried out for all buildings (other than those exempt from the Earthquake Prone Building definition in the Building Act). It is anticipated that CERA will adopt the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011. This document sets out a methodology for both qualitative and quantitative assessments.

The qualitative assessment is a desk-top and site inspection assessment. It is based on a thorough visual inspection of the building coupled with a review of available documentation such as drawings and specifications. The quantitative assessment involves analytical calculation of the buildings strength and may require non-destructive or destructive material testing, geotechnical testing and intrusive investigation.

It is anticipated that factors determining the extent of evaluation and strengthening level required will include:

- The importance level and occupancy of the building
- The placard status and amount of damage
- The age and structural type of the building
- Consideration of any critical structural weaknesses
- The extent of any earthquake damage

Building Act

Several sections of the Building Act are relevant when considering structural requirements:

Section 112 – Alterations

This section requires that an existing building complies with the relevant sections of the Building Code to at least the extent that it did prior to any alteration. This effectively means that a building cannot be weakened as a result of an alteration (including partial demolition).

Section 115 – Change of Use

This section requires that the territorial authority (in this case Christchurch City Council (CCC)) be satisfied that the building with a new use complies with the relevant sections of the Building Code 'as near as is reasonably practicable'. Regarding seismic capacity 'as near as reasonably practicable' has previously been interpreted by CCC as achieving a minimum of 67%NBS however where practical achieving 100%NBS is desirable. The New Zealand Society for Earthquake Engineering (NZSEE) recommend a minimum of 67%NBS.

Section 121 – Dangerous Buildings

The definition of dangerous building in the Act was extended by the Canterbury Earthquake (Building Act) Order 2010, and it now defines a building as dangerous if:

- in the ordinary course of events (excluding the occurrence of an earthquake), the building is likely to cause injury or death or damage to other property; or
- in the event of fire, injury or death to any persons in the building or on other property is likely because of fire hazard or the occupancy of the building; or
- there is a risk that the building could collapse or otherwise cause injury or death as a result of earthquake shaking that is less than a 'moderate earthquake' (refer to Section 122 below); or
- there is a risk that that other property could collapse or otherwise cause injury or death; or
- a territorial authority has not been able to undertake an inspection to determine whether the building is dangerous.

Section 122 – Earthquake Prone Buildings

This section defines a building as earthquake prone if its ultimate capacity would be exceeded in a 'moderate earthquake' and it would be likely to collapse causing injury or death, or damage to other property. A

moderate earthquake is defined by the building regulations as one that would generate ground shaking 33% of the shaking used to design an equivalent new building.

Section 124 – Powers of Territorial Authorities

This section gives the territorial authority the power to require strengthening work within specified timeframes or to close and prevent occupancy to any building defined as dangerous or earthquake prone.

Section 131 – Earthquake Prone Building Policy

This section requires the territorial authority to adopt a specific policy for earthquake prone, dangerous and insanitary buildings.

Christchurch City Council Policy

Christchurch City Council adopted their Earthquake Prone, Dangerous and Insanitary Building Policy in 2006. This policy was amended immediately following the Darfield Earthquake of the 4th September 2010.

The 2010 amendment includes the following:

- A process for identifying, categorising and prioritising Earthquake Prone Buildings, commencing on 1 July 2012;
- A strengthening target level of 67% of a new building for buildings that are Earthquake Prone;
- A timeframe of 15-30 years for Earthquake Prone Buildings to be strengthened; and,
- Repair works for buildings damaged by earthquakes will be required to comply with the above.

The council has stated their willingness to consider retrofit proposals on a case by case basis, considering the economic impact of such a retrofit.

We anticipate that any building with a capacity of less than 33%NBS (including consideration of critical structural weaknesses) will need to be strengthened to a target of 67%NBS of new building standard as recommended by the Policy.

If strengthening works are undertaken, a building consent will be required. A requirement of the consent will require upgrade of the building to comply 'as near as is reasonably practicable' with:

- The accessibility requirements of the Building Code.
- The fire requirements of the Building Code. This is likely to require a fire report to be submitted with the building consent application.

Building Code

The building code outlines performance standards for buildings and the Building Act requires that all new buildings comply with this code. Compliance Documents published by The Department of Building and Housing can be used to demonstrate compliance with the Building Code.

After the February Earthquake, on 19 May 2011, Compliance Document B1: Structure was amended to include increased seismic design requirements for Canterbury as follows:

- Hazard Factor increased from 0.22 to 0.3 (36% increase in the basic seismic design load)
- Serviceability Return Period Factor increased from 0.25 to 0.33 (80% increase in the serviceability design loads when combined with the Hazard Factor increase)

The increase in the above factors has resulted in a reduction in the level of compliance of an existing building relative to a new building despite the capacity of the existing building not changing.

Appendix E

Standard Reporting Spread Sheet

Detailed Engineering Evaluation Summary Data

V1.11

| | | | |
|---|------------------|---|----------------------|
| Location | | Building Name: Englefield Reserve toilet | Reviewer: Lee Howard |
| | Unit No: Street | | CPEng No: |
| Building Address: | 65 Englefield Rd | Company: Aurecon | |
| Legal Description: RS 41514 | | Company project number: 229172 | |
| | | Company phone number: 03 375 0761 | |
| | Degrees Min Sec | Date of submission: Jul-12 | |
| GPS south: 43 27 22.03 | | Inspection Date: 29/05/2012 | |
| GPS east: 172 37 5.95 | | Revision: 2 | |
| Building Unique Identifier (CCC): PRK 0362 BLDG 001 | | Is there a full report with this summary? yes | |

| | | | |
|---------------------------------------|------------------|--|------------------------------|
| Site | | Site slope: flat | Max retaining height (m): |
| | Soil type: mixed | | Soil Profile (if available): |
| Site Class (to NZS1170.5): D | | If Ground improvement on site, describe: | |
| Proximity to waterway (m, if <100m): | | Approx site elevation (m): 17.00 | |
| Proximity to clifftop (m, if < 100m): | | | |
| Proximity to cliff base (m,if <100m): | | | |

| | | | | |
|--------------------------------------|--|--------------------------------|---|---|
| Building | | No. of storeys above ground: 1 | single storey = 1 | Ground floor elevation (Absolute) (m): |
| Ground floor split? no | | Storesys below ground: 0 | | Ground floor elevation above ground (m): 0.10 |
| Foundation type: strip footings | | Building height (m): 2.20 | if Foundation type is other, describe: | |
| Floor footprint area (approx): 5 | | Age of Building (years): 19 | height from ground to level of uppermost seismic mass (for IEP only) (m): | |
| Strengthening present? no | | | Date of design: 1992-2004 | |
| Use (ground floor): public | | | If so, when (year)? | |
| Use (upper floors): | | | And what load level (%g)? | |
| Use notes (if required): | | | Brief strengthening description: | |
| Importance level (to NZS1170.5): IL1 | | | | |

| | | | |
|--------------------------|--|------------------------------|--|
| Gravity Structure | | Gravity System: frame system | truss depth, purlin type and cladding |
| Roof: timber truss | | Floors: concrete flat slab | truss depth= 0.5m, purlin= wood |
| Beams: timber | | Columns: timber | 75x50mm, cladding= corrugated metal |
| Walls: non-load bearing | | | slab thickness (mm) 100 |
| | | | typical dimensions (mm x mm) type stud |
| | | | 100x50 |
| | | | 0 |

| | | | | |
|---|------|---|---|-----------|
| Lateral load resisting structure | | Lateral system along: lightweight timber framed walls | Note: Define along and across in detailed report! | 2.2 |
| Ductility assumed, μ : | 3.00 | Period along: 0.40 | note typical wall length (m) | |
| Total deflection (ULS) (mm): | 35 | maximum interstorey deflection (ULS) (mm): 35 | estimate or calculation? | estimated |
| | | | estimate or calculation? | estimated |
| | | | estimate or calculation? | estimated |

Lateral system across:

Ductility assumed, μ :

Period across:

Total deflection (ULS) (mm):

maximum interstorey deflection (ULS) (mm):

0.00

note typical wall length (m)

estimate or calculation?

estimate or calculation?

estimate or calculation?

Separations:

north (mm):

east (mm):

south (mm):

west (mm):

leave blank if not relevant

Non-structural elements

Stairs:

Wall cladding:

Roof Cladding:

Glazing:

Ceilings:

Services(list):

describe

describe

Available documentation

Architectural:

Structural:

Mechanical:

Electrical:

Geotech report:

original designer name/date

original designer name/date

original designer name/date

original designer name/date

Damage

Site:
(refer DEE Table 4-2)

Site performance:

Describe damage:

Settlement:

Differential settlement:

Liquefaction:

Lateral Spread:

Differential lateral spread:

Ground cracks:

Damage to area:

notes (if applicable):

Building:

Current Placard Status:

Along

Damage ratio:

Describe how damage ratio arrived at:

Describe (summary):

Across

Damage ratio:

$$Damage_Ratio = \frac{(\%NBS(before) - \%NBS(after))}{\%NBS(before)}$$

Describe (summary):

Diaphragms

Damage?:

Describe:

CSWs:

Damage?:

Describe:

Pounding:

Damage?:

Describe:

Non-structural:

Damage?:

Describe:

Recommendations

Level of repair/strengthening required:
 Building Consent required:
 Interim occupancy recommendations:

Describe:
 Describe:
 Describe:

Along Assessed %NBS before e'quakes: ##### %NBS from IEP below
 Assessed %NBS after e'quakes:

If IEP not used, please detail assessment methodology:

Across Assessed %NBS before e'quakes: ##### %NBS from IEP below
 Assessed %NBS after e'quakes:

IEP

Use of this method is not mandatory - more detailed analysis may give a different answer, which would take precedence. Do not fill in fields if not using IEP.

Period of design of building (from above): 1992-2004

h_n from above: m

Seismic Zone, if designed between 1965 and 1992:

not required for this age of building
 Design Soil type from NZS4203:1992, cl 4.6.2.2:

| | along | across |
|-------------------------------------|----------------------|----------------------|
| Period (from above): | 0.4 | 0.4 |
| (%NBS) _{nom} from Fig 3.3: | <input type="text"/> | <input type="text"/> |

Note:1 for specifically design public buildings, to the code of the day: pre-1965 = 1.25; 1965-1976, Zone A =1.33; 1965-1976, Zone B = 1.2; all else 1.0

Note 2: for RC buildings designed between 1976-1984, use 1.2

Note 3: for buildngs designed prior to 1935 use 0.8, except in Wellington (1.0)

| |
|-----------------------------------|
| <input type="text" value="1.00"/> |
| <input type="text" value="1.0"/> |
| <input type="text" value="1.0"/> |

| | along | across |
|-------------------------------|-------|--------|
| Final (%NBS) _{nom} : | 0% | 0% |

2.2 Near Fault Scaling Factor

Near Fault scaling factor, from NZS1170.5, cl 3.1.6:

| | along | across |
|---|-------|--------|
| Near Fault scaling factor (1/N(T,D), Factor A): | 1 | 1 |

2.3 Hazard Scaling Factor

Hazard factor Z for site from AS1170.5, Table 3.3:
 Z_{1992} , from NZS4203:1992:
 Hazard scaling factor, **Factor B**:

2.4 Return Period Scaling Factor

Building Importance level (from above):
 Return Period Scaling factor from Table 3.1, **Factor C**:

2.5 Ductility Scaling Factor

| | along | across |
|---|----------------------|----------------------|
| Assessed ductility (less than max in Table 3.2) | 1.00 | 1.00 |
| Ductility scaling factor: =1 from 1976 onwards; or = k_{μ} , if pre-1976, from Table 3.3: | <input type="text"/> | <input type="text"/> |

| | | |
|---|------|------|
| Ductility Scaling Factor, Factor D : | 1.00 | 1.00 |
|---|------|------|

2.6 Structural Performance Scaling Factor:

Sp:

| | | |
|---|---|---|
| Structural Performance Scaling Factor Factor E : | 1 | 1 |
|---|---|---|

2.7 Baseline %NBS, (NBS%)_b = (%NBS)_{nom} x A x B x C x D x E

| | | |
|---------------------|---------|---------|
| %NBS _b : | #DIV/0! | #DIV/0! |
|---------------------|---------|---------|

Global Critical Structural Weaknesses: (refer to NZSEE IEP Table 3.4)

3.1. Plan Irregularity, factor A:

3.2. Vertical irregularity, Factor B:

3.3. Short columns, Factor C:

3.4. Pounding potential
Pounding effect D1, from Table to right
Height Difference effect D2, from Table to right

Therefore, Factor D:

3.5. Site Characteristics

| Table for selection of D1 | Severe | Significant | Insignificant/none |
|---|---------------------------|---------------|--------------------|
| | Separation 0<sep<.005H | .005<sep<.01H | Sep>.01H |
| Alignment of floors within 20% of H | 0.7 | 0.8 | 1 |
| Alignment of floors not within 20% of H | 0.4 | 0.7 | 0.8 |

| Table for Selection of D2 | Severe | Significant | Insignificant/none |
|----------------------------------|---------------------------|---------------|--------------------|
| | Separation 0<sep<.005H | .005<sep<.01H | Sep>.01H |
| Height difference > 4 storeys | 0.4 | 0.7 | 1 |
| Height difference 2 to 4 storeys | 0.7 | 0.9 | 1 |
| Height difference < 2 storeys | 1 | 1 | 1 |

3.6. Other factors, Factor F For ≤ 3 storeys, max value =2.5, otherwise max valule =1.5, no minimum
Rationale for choice of F factor, if not 1

Detail Critical Structural Weaknesses: (refer to DEE Procedure section 6)
List any: Refer also section 6.3.1 of DEE for discussion of F factor modification for other critical structural weaknesses

3.7. Overall Performance Achievement ratio (PAR)

4.3 PAR x (%NBS)b: PAR x Baseline %NBS:

4.4 Percentage New Building Standard (%NBS), (before)



Aurecon New Zealand Limited
Level 2, 518 Colombo Street
Christchurch 8011

PO Box 1061
Christchurch 8140
New Zealand

T +64 3 366 0821

F +64 3 379 6955

E christchurch@aurecongroup.com

W aurecongroup.com

Aurecon offices are located in:
Angola, Australia, Botswana, China,
Ethiopia, Hong Kong, Indonesia,
Lesotho, Libya, Malawi, Mozambique,
Namibia, New Zealand, Nigeria,
Philippines, Singapore, South Africa,
Swaziland, Tanzania, Thailand, Uganda,
United Arab Emirates, Vietnam.