

*Christchurch City Council*

**Reg Adams Courts  
Housing Complex  
PRO 0583**

**Detailed Engineering Evaluation  
Quantitative Assessment Report**



*Christchurch City Council*

---

# **Reg Adams Courts Housing Complex**

## **Quantitative Assessment Report**


**445 Papanui Road, Strowan,**

Prepared By

  
-----  
Claire Ford  
Engineering Assistant


Opus International Consultants Ltd  
Christchurch Office  
20 Moorhouse Avenue  
PO Box 1482, Christchurch Mail  
Centre, Christchurch 8140  
New Zealand

Reviewed By

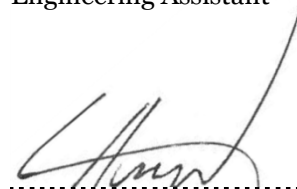  
-----  
Lachlan Howat  
Structural Engineer

Telephone: +64 3 363 5400  
Facsimile: +64 3 365 7858

Approved for  
Release By

  
-----  
Mary Ann Halliday  
Senior Structural Engineer

Date: February 2014  
Reference: 6-QC394.00  
Status: Final

# Summary

Reg Adams Courts Housing Complex  
PRO 0583

Detailed Engineering Evaluation  
Quantitative Report - Summary  
Final

## Background

This is a summary of the quantitative report for the Reg Adams Courts Housing Complex, and is based on the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011. This assessment covers the 14 residential units, 2 garages and 1 double car-port on the site.

## Key Damage Observed

The residential units have suffered minor to moderate damage to the foundations and to non-structural elements. A horizontal crack through the foundations was observed at the front of all units. There is moderate damage to the roofline of most units due to buckling of metal during the earthquakes. This damage was deemed low enough to not affect the capacities of the buildings.

## Level Survey

All accessible floor slopes were assessed in a laser level survey. None of the floor slopes were greater than the 5mm/m limitation set out in the MBIE guidelines [6], as shown below.

## Internal Lining Nail Spacings

The internal lining nail spacings were measured on site to vary between 200 – 250 mm.

## Critical Structural Weaknesses

No critical structural weaknesses were found in any of the buildings.

## Indicative Building Strength

**Table A: Summary of Seismic Performance by Blocks**

Block	NBS%	Floor Levels	Nail Spacings
PRO 0583 B001 (Block A)	53%	Pass	Pass
PRO 0583 B002 (Block B)	53%	Pass	Pass
PRO 0583 B003 (Block C)	53%	Pass	Pass
PRO 0583 B004 (Block D)	53%	Pass	Pass
PRO 0583 B005 (Block E - Garages)	100%	Pass	Pass

No buildings on the site are considered to be earthquake prone.

The residential units (Blocks A – D) have capacities of 53% NBS as limited by the in-plane shear capacity of the timber-framed walls in the longitudinal direction. They are deemed to be a ‘moderate risk’ in a design seismic event according to NZSEE guidelines.

The garages (Block E) have a capacity of greater than 100% NBS. They are deemed to be a ‘low risk’ in a design seismic event according to NZSEE guidelines.

Increasing the number of nails in the plasterboard will not significantly improve the strength of the buildings.

### **Recommendations**

It is recommended that;

- Veneer at height (gable ends) have the veneer ties checked.
- Repair render on the foundation.
- Cosmetic repairs be undertaken as required.
- Strengthening schemes be developed to increase the seismic capacity of Blocks A – D to at least 67%NBS.

# Contents

<b>Summary .....</b>	<b>i</b>
<b>1 Introduction.....</b>	<b>4</b>
<b>2 Compliance .....</b>	<b>4</b>
<b>3 Earthquake Resistance Standards.....</b>	<b>8</b>
<b>4 Background Information.....</b>	<b>10</b>
<b>5 Damage .....</b>	<b>14</b>
<b>6 Detailed Seismic Assessment .....</b>	<b>15</b>
<b>7 Geotechnical Summary .....</b>	<b>19</b>
<b>8 Conclusions.....</b>	<b>19</b>
<b>9 Recommendations .....</b>	<b>20</b>
<b>10 Limitations.....</b>	<b>20</b>
<b>11 References .....</b>	<b>20</b>
<b>Appendix A – Photographs</b>	
<b>Appendix B – Methodology and Assumptions</b>	
<b>Appendix C – CERA DEE Spreadsheet</b>	

# 1 Introduction

Opus International Consultants Limited has been engaged by Christchurch City Council to undertake a detailed seismic assessment of the Reg Adams Courts Housing Complex, located at 445 Papanui Road, Strowan, following the Canterbury earthquake sequence since September 2010. The site was visited by Opus International Consultants on 20 November 2013.

The purpose of the assessment is to determine if the buildings in the complex are classed as being earthquake prone in accordance with the Building Act 2004.

The seismic assessment and reporting have been undertaken based on the qualitative and quantitative procedures detailed in the Detailed Engineering Evaluation Procedure (DEEP) document (draft) issued by the Structural Engineering Society (SESOC) [2] [3] [4] [5].

## 2 Compliance

This section contains a brief summary of the requirements of the various statutes and authorities that control activities in relation to buildings in Christchurch at present.

### 2.1 Canterbury Earthquake Recovery Authority (CERA)

CERA was established on 28 March 2011 to take control of the recovery of Christchurch using powers established by the Canterbury Earthquake Recovery Act enacted on 18 April 2011. This act gives the Chief Executive Officer of CERA wide powers in relation to building safety, demolition and repair. Two relevant sections are:

#### Section 38 – Works

This section outlines a process in which the chief executive can give notice that a building is to be demolished and if the owner does not carry out the demolition, the chief executive can commission the demolition and recover the costs from the owner or by placing a charge on the owners' land.

#### Section 51 – Requiring Structural Survey

This section enables the chief executive to require a building owner, insurer or mortgagee to carry out a full structural survey before the building is re-occupied.

We understand that CERA require a detailed engineering evaluation to be carried out for all buildings (other than those exempt from the Earthquake Prone Building definition in the Building Act). CERA have adopted the Detailed Engineering Evaluation Procedure (DEEP) document (draft) issued by the Structural Engineering Society (SESOC) on 19 July 2011. This document sets out a methodology for both initial qualitative and detailed quantitative assessments.

It is anticipated that a number of factors, including the following, will determine the extent of evaluation and strengthening level required:

1. The importance level and occupancy of the building.

2. The placard status and amount of damage.
3. The age and structural type of the building.
4. Consideration of any critical structural weaknesses.

Christchurch City Council requires any building with a capacity of less than 34% of New Building Standard (including consideration of critical structural weaknesses) to be strengthened to a target of 67% as required under the CCC Earthquake Prone Building Policy.

## 2.2 Building Act

Several sections of the Building Act are relevant when considering structural requirements:

### Section 112 – Alterations

This section requires that an existing building complies with the relevant sections of the Building Code to at least the extent that it did prior to the alteration. This effectively means that a building cannot be weakened as a result of an alteration (including partial demolition).

The Earthquake Prone Building policy for the territorial authority shall apply as outlined in Section 2.3 of this report.

### Section 115 – Change of Use

This section requires that the territorial authority is satisfied that the building with a new use complies with the relevant sections of the Building Code ‘as near as is reasonably practicable’.

This is typically interpreted by territorial authorities as being 67% of the strength of an equivalent new building or as near as practicable. This is also the minimum level recommended by the New Zealand Society for Earthquake Engineering (NZSEE).

### Section 121 – Dangerous Buildings

This section was extended by the Canterbury Earthquake (Building Act) Order 2010, and defines a building as dangerous if:

1. In the ordinary course of events (excluding the occurrence of an earthquake), the building is likely to cause injury or death or damage to other property; or
2. In the event of fire, injury or death to any persons in the building or on other property is likely because of fire hazard or the occupancy of the building; or
3. There is a risk that the building could collapse or otherwise cause injury or death as a result of earthquake shaking that is less than a ‘moderate earthquake’ (refer to Section 122 below); or
4. There is a risk that other property could collapse or otherwise cause injury or death;  
or
5. A territorial authority has not been able to undertake an inspection to determine whether the building is dangerous.

### **Section 122 – Earthquake Prone Buildings**

This section defines a building as earthquake prone (EPB) if its ultimate capacity would be exceeded in a ‘moderate earthquake’ and it would be likely to collapse causing injury or death, or damage to other property.

A moderate earthquake is defined by the building regulations as one that would generate loads 33% of those used to design an equivalent new building.

### **Section 124 – Powers of Territorial Authorities**

This section gives the territorial authority the power to require strengthening work within specified timeframes or to close and prevent occupancy to any building defined as dangerous or earthquake prone.

### **Section 131 – Earthquake Prone Building Policy**

This section requires the territorial authority to adopt a specific policy for earthquake prone, dangerous and insanitary buildings.

## **2.3 Christchurch City Council Policy**

Christchurch City Council adopted their Earthquake Prone, Dangerous and Insanitary Building Policy in October 2011 following the Darfield Earthquake on 4 September 2010.

The policy includes the following:

1. A process for identifying, categorising and prioritising Earthquake Prone Buildings, commencing on 1 July 2012;
2. A strengthening target level of 67% of a new building for buildings that are Earthquake Prone;
3. A timeframe of 15-30 years for Earthquake Prone Buildings to be strengthened; and,
4. Repair works for buildings damaged by earthquakes will be required to comply with the above.

The council has stated their willingness to consider retrofit proposals on a case by case basis, considering the economic impact of such a retrofit.

If strengthening works are undertaken, a building consent will be required. A requirement of the consent will require upgrade of the building to comply ‘as near as is reasonably practicable’ with:

- The accessibility requirements of the Building Code.
- The fire requirements of the Building Code. This is likely to require a fire report to be submitted with the building consent application.

Where an application for a change of use of a building is made to Council, the building will be required to be strengthened to 67% of New Building Standard or as near as is reasonably practicable.



## 2.4 Building Code

The Building Code outlines performance standards for buildings and the Building Act requires that all new buildings comply with this code. Compliance Documents published by The Department of Building and Housing can be used to demonstrate compliance with the Building Code.

On 19 May 2011, Compliance Document B1: Structure, was amended to include increased seismic design requirements for Canterbury as follows:

- Increase in the basic seismic design load for the Canterbury earthquake region (Z factor increased to 0.3 equating to an increase of 36 – 47% depending on location within the region);
- Increased serviceability requirements.

## 2.5 Institution of Professional Engineers New Zealand (IPENZ) Code of Ethics

One of the core ethical values of professional engineers in New Zealand is the protection of life and safeguarding of people. The IPENZ Code of Ethics requires that:

*Members shall recognise the need to protect life and to safeguard people, and in their engineering activities shall act to address this need.*

- 1.1 *Giving Priority to the safety and well-being of the community and having regard to this principle in assessing obligations to clients, employers and colleagues.*
- 1.2 *Ensuring that responsible steps are taken to minimise the risk of loss of life, injury or suffering which may result from your engineering activities, either directly or indirectly.*

All recommendations on building occupancy and access must be made with these fundamental obligations in mind.

### 3 Earthquake Resistance Standards

For this assessment, the building’s earthquake resistance is compared with the current New Zealand Building Code requirements for a new building constructed on the site. This is expressed as a percentage of new building standard (%NBS). The loadings are in accordance with the current earthquake loading standard NZS1170.5 [1].

A generally accepted classification of earthquake risk for existing buildings in terms of %NBS that has been proposed by the NZSEE 2006 [2] is presented in Figure 1 below.

Description	Grade	Risk	%NBS	Existing Building Structural Performance	Improvement of Structural Performance	
					Legal Requirement	NZSEE Recommendation
Low Risk Building	A or B	Low	Above 67	Acceptable (improvement may be desirable)	The Building Act sets no required level of structural improvement (unless change in use). This is for each TA to decide. Improvement is not limited to 34%NBS.	100%NBS desirable. Improvement should achieve at least 67%NBS
Moderate Risk Building	B or C	Moderate	34 to 66	Acceptable legally. Improvement recommended		Not recommended. Acceptable only in exceptional circumstances
High Risk Building	D or E	High	33 or lower	Unacceptable (Improvement required under Act)	Unacceptable	Unacceptable

Figure 1: NZSEE Risk Classifications Extracted from table 2.2 of the NZSEE 2006 AISPBE Guidelines [2]

Table 1 below compares the percentage NBS to the relative risk of the building failing in a seismic event with a 10% risk of exceedance in 50 years (i.e. 0.2% in the next year).

Table 1: %NBS compared to relative risk of failure

Percentage of New Building Standard (%NBS)	Relative Risk (Approximate)
>100	<1 time
80-100	1-2 times
67-80	2-5 times
33-67	5-10 times
20-33	10-25 times
<20	>25 times

## 3.1 Minimum and Recommended Standards

Based on governing policy and recent observations, Opus makes the following general recommendations:

### 3.1.1 Occupancy

The Canterbury Earthquake Order<sup>1</sup> in Council 16 September 2010, modified the meaning of “dangerous building” to include buildings that were identified as being EPB’s. As a result of this, we would expect such a building would be issued with a Section 124 notice, by the Territorial Authority, or CERA acting on their behalf, once they are made aware of our assessment. Based on information received from CERA to date and from the MBIE guidance document dated December 2012 [6], this notice is likely to prohibit occupancy of the building (or parts thereof), until its seismic capacity is improved to the point that it is no longer considered an EPB.

### 3.1.2 Cordoning

Where there is an overhead falling hazard, or potential collapse hazard of the building, the areas of concern should be cordoned off in accordance with current CERA/territorial authority guidelines.

### 3.1.3 Strengthening

Industry guidelines (NZSEE 2006 [2]) strongly recommend that every effort be made to achieve improvement to at least 67%NBS. A strengthening solution to anything less than 67%NBS would not provide an adequate reduction to the level of risk.

It should be noted that full compliance with the current building code requires building strength of 100%NBS.

### 3.1.4 Our Ethical Obligation

In accordance with the IPENZ code of ethics, we have a duty of care to the public. This obligation requires us to identify and inform CERA of potentially dangerous buildings; this would include earthquake prone buildings.

---

<sup>1</sup> This Order only applies to buildings within the Christchurch City, Selwyn District and Waimakariri District Councils authority.

## 4 Background Information

### 4.1 Building Descriptions

The site contains 14 residential units which were constructed in 1980. There are also 2 garages and a double carport on site. A site plan showing the location of the units, numbered 1 to 14, and the garages is shown in Figure 2. Figure 3 shows the location of the site in Christchurch City. The units are grouped together to form four blocks of two, four or six units.

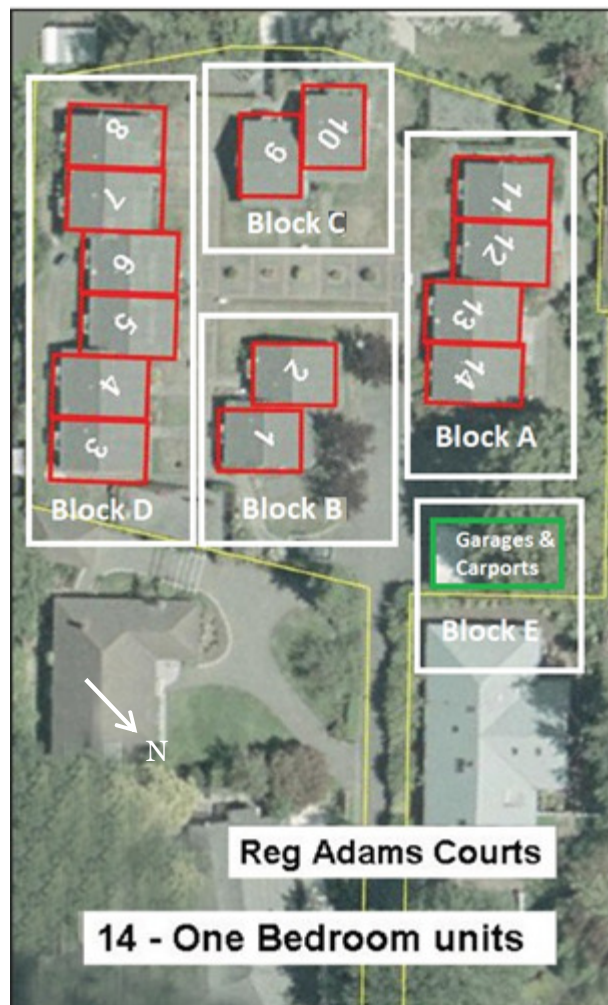
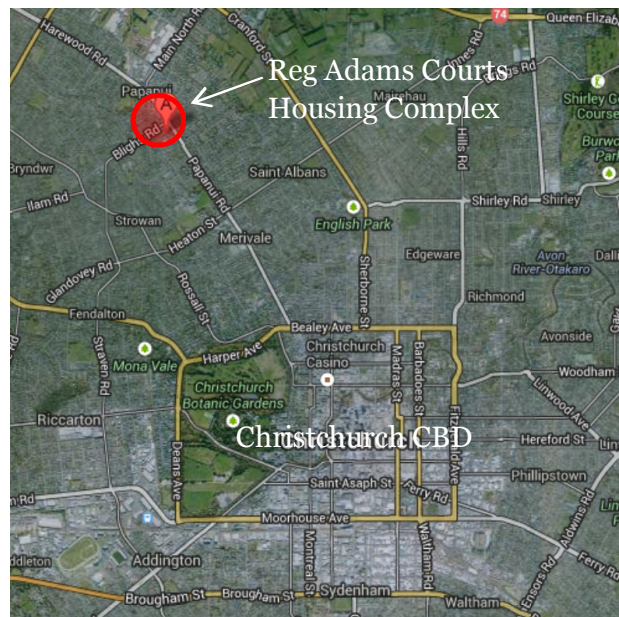


Figure 2: Site plan of Reg Adams Courts Housing Complex.



**Figure 3: Location of Reg Adams Courts (circled) relative to Christchurch City CBD (Source: Google Earth).**

The residential units are timber-framed buildings with diagonal timber braces. The roof structure comprises of timber roof trusses supporting light-weight metal roofs. The walls and ceilings are lined with plasterboard. External walls are clad with concrete block veneer. Foundations are strip footings under fire walls and around the perimeter of reinforced concrete slabs.

The units are separated by a 100mm precast panel fire walls which are reinforced with 10mm diameter reinforcement at 400mm centres.

The garages and carport on the site are concrete block construction. The roof structure comprises of timber framing supporting a light weight metal roof with timber sarking.

Figure 4 shows a typical floor plan of a residential unit produced from site measurements by Opus. Figure 5 shows the cross section used in calculations.

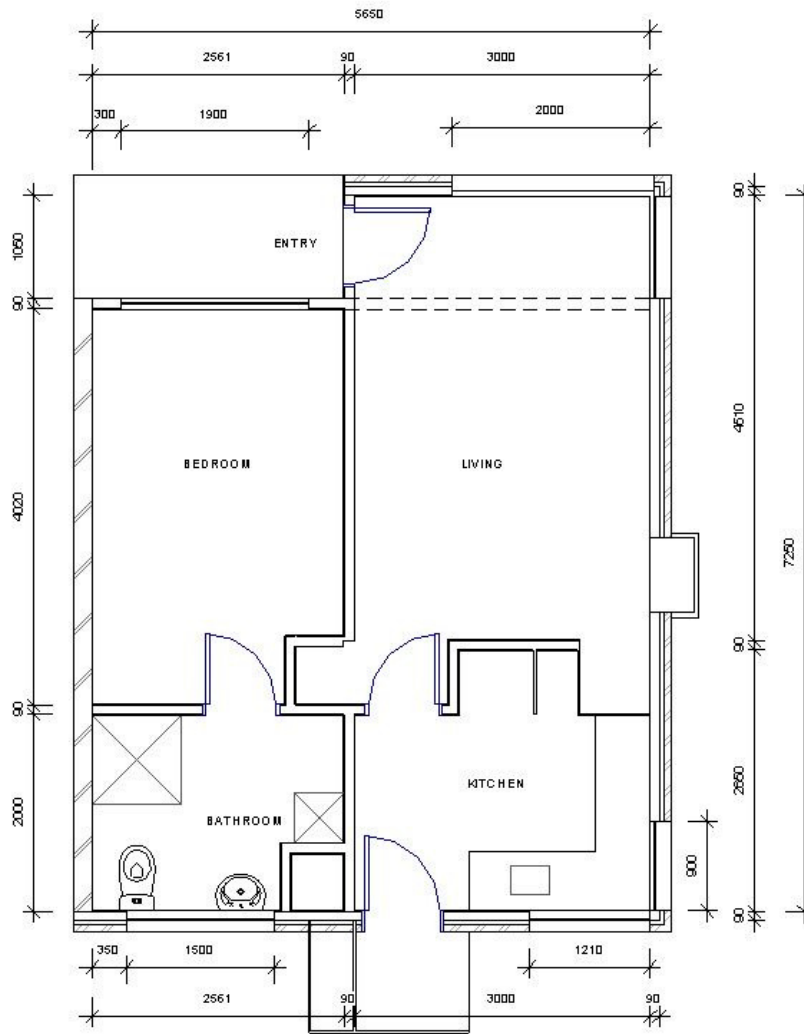


Figure 4: Typical partial floor plan of residential unit blocks.

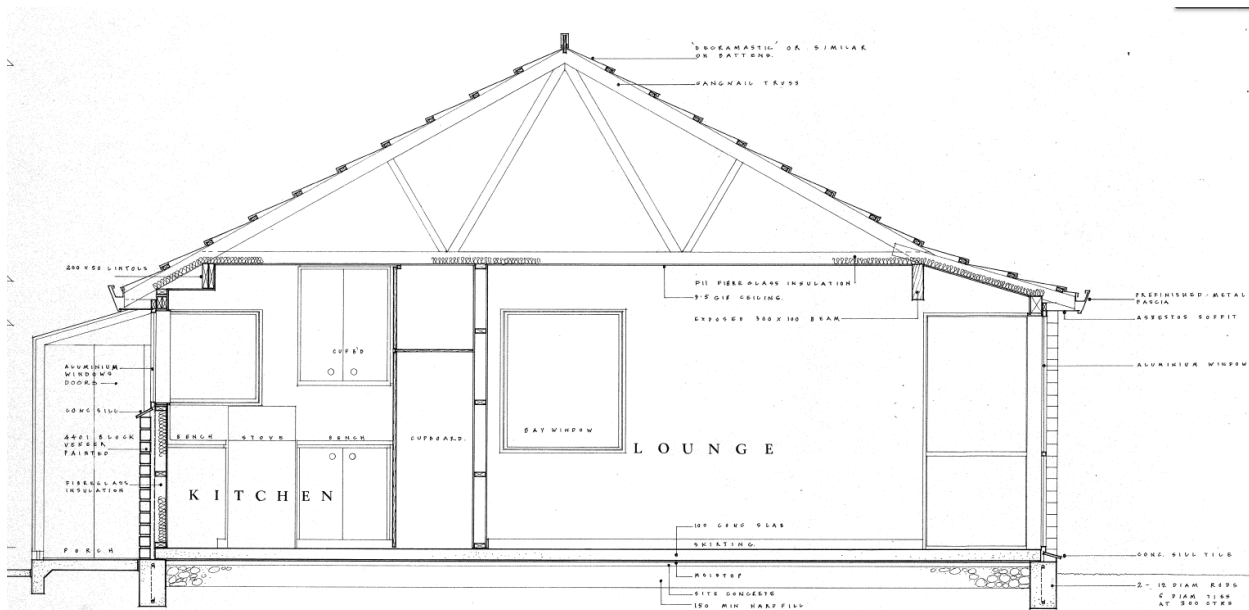


Figure 5: Cross section of Reg Adams Courts .

## 4.2 Survey

### 4.2.1 Level Survey

A full level survey was not deemed to be necessary at Reg Adams Courts as it is located in a TC2 zone. Properties in TC2 zones suffered minor to moderate damage due to liquefaction and/or settlement. In lieu of a full level survey, a laser level was placed in each unit so that differentials in vertical levels could be measured at the extreme ends of the unit. These values could then be used to determine the floor slope of the entire unit. For this site, all floor slopes were less than the 5mm/m limitation imposed by MBIE guidelines.

**Table 2: Summary of the level survey**

Block	Unit No.	Comment	Maximum Fall
B	1	Pass	-
	2	Pass	-
D	3	Pass	-
	4	Pass	-
	5	Pass	-
	6	Pass	-
	7	Pass	-
	8	Pass	-
C	9	Pass	-
	10	Pass	-
A	11	Pass	
	12	Pass	
	13	Pass	
	14	Pass	
E	Garages	Pass	

\* Values are only recorded if greater than 5mm/m

### 4.2.2 Nail Spacings

The internal lining nail spacings were measured on site to vary between 200–250 mm.

## 4.3 Original Documentation

The following documentation was provided by the Christchurch City Council:

- D.2319 – Christchurch City Council – Papanui Road 445 E.P.H. Development – Construction details and site drainage plan – 1979.
- 601 – Warren R. Louis – Firewalls for CCC Housing, Adams Estate – Firewall details – 1979.



- Duder Homes Ltd. – Adams Estate, Christchurch City Council Housing for the Elderly, 445 Papanui Road – Architectural sections, plans, elevations, perspectives – 1979.

In addition a typical floor plan of the residential units has been produced by Opus from site measurements to help investigate potential critical structural weaknesses (CSWs) and identify details which required particular attention.

Copies of design calculations were not available for the site assessment.

## 5 Damage

This section outlines the damage to the buildings that was observed during site visits. It is not intended to be a complete summary of the damage sustained by the buildings due to the earthquakes. Some forms of damage may not be able to be identified with a visual inspection only.

Note: Any photo referenced in this section can be found in Appendix A.

### 5.1 Residual Displacements

Displacements were observed to be less than the 5mm/m MBIE guideline in all units inspected.

### 5.2 Foundations

Horizontal cracking was observed in the render on the foundations of all units (photo 8). This was most significant in Units 9 and 10.

No damage was observed to the foundations of the garages and car port.

### 5.3 Primary Gravity Structure

No damage was observed to the primary gravity structure.

### 5.4 Primary Lateral-Resistance Structure

Minor damage to the interior wall linings was observed in all units, in particular the crack in the plasterboard linings at either end of the ceiling beam (photo 9) in the living room of each unit.

### 5.5 Non Structural Elements

Moderate damage was observed to the roof line of all units where they had been pinched or pushed up by the roof structure.

### 5.6 General Observations

The buildings appeared to have performed reasonably well, as would be expected for buildings of this type, during the earthquakes. They have suffered distributed amounts of minor damage which is typical of the type and age of construction.



## 6 Detailed Seismic Assessment

The detailed seismic assessment has been based on the NZSEE 2006 [2] guidelines for the “Assessment and Improvement of the Structural Performance of Buildings in Earthquakes” together with the “Guidance on Detailed Engineering Evaluation of Earthquake Affected Non-residential Buildings in Canterbury, Part 2 Evaluation Procedure” [3] draft document prepared by the Engineering Advisory Group on 19 July 2011, and the SESOC guidelines “Practice Note – Design of Conventional Structural Systems Following Canterbury Earthquakes” [5] issued on 21 December 2011.

As the residential units have the same floor plan, the analysis was simplified by conducting the analysis of one multi-unit block with similar cladding and using this for all multi-unit blocks.

### 6.1 Critical Structural Weaknesses

The term Critical Structural Weakness (CSW) refers to a component of a building that could contribute to increased levels of damage or cause premature collapse of a building.

No CSWs were identified in the buildings.

### 6.2 Quantitative Assessment Methodology

The assessment assumptions and methodology have been included in Appendix B. A brief summary follows:

Hand calculations were performed to determine seismic forces from the current building codes. These forces were applied globally to the structure and the capacities of the walls were calculated and used to estimate the %NBS. The walls, highlighted in Figure 6 and Figure 7, were used for bracing in their respective directions.

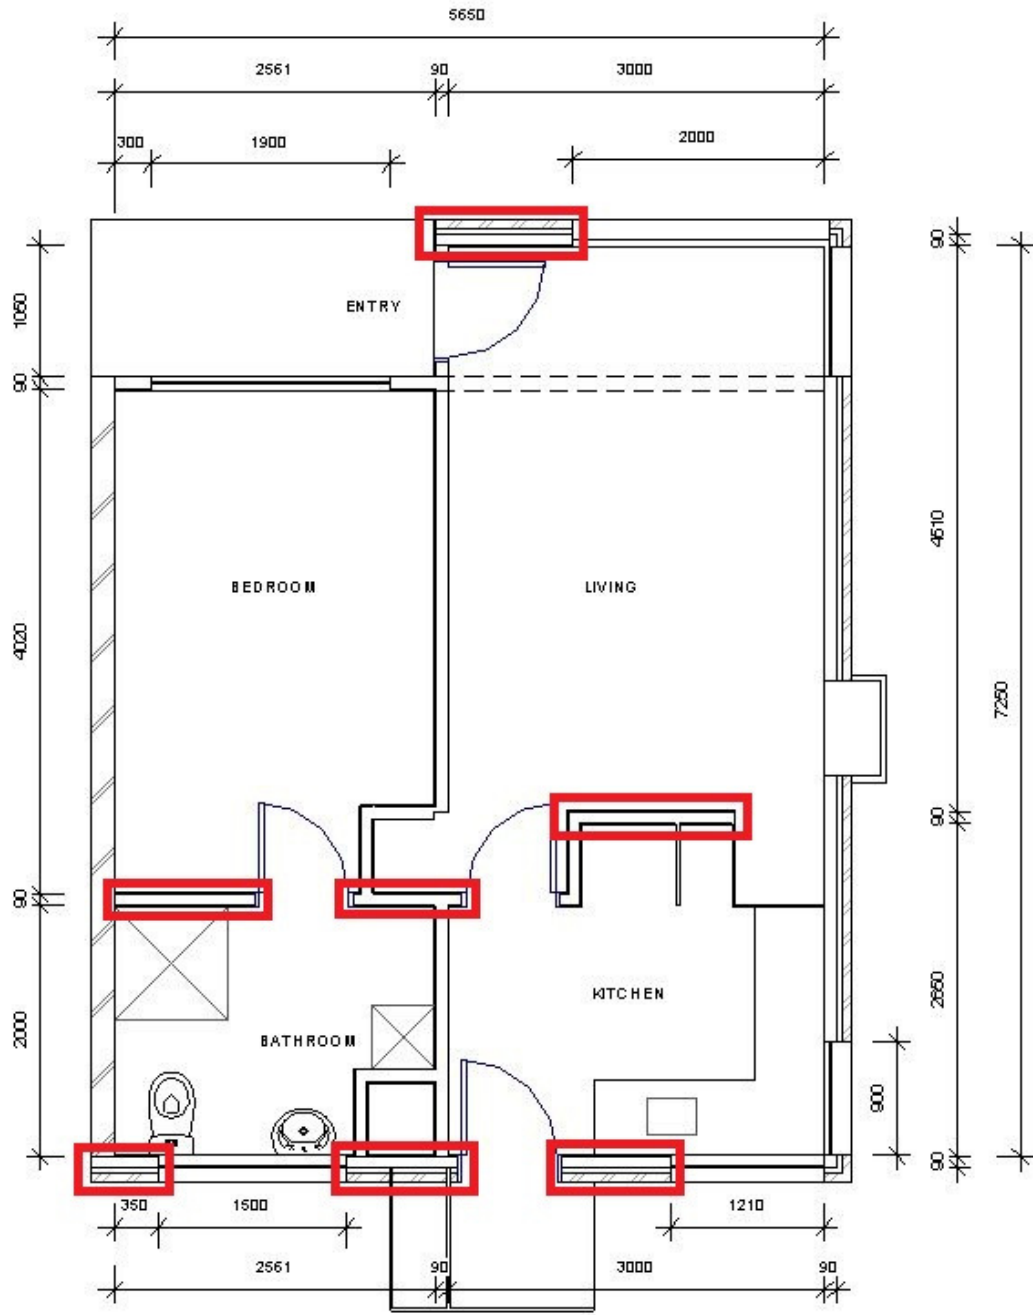


Figure 6: Walls used for bracing in the longitudinal direction.

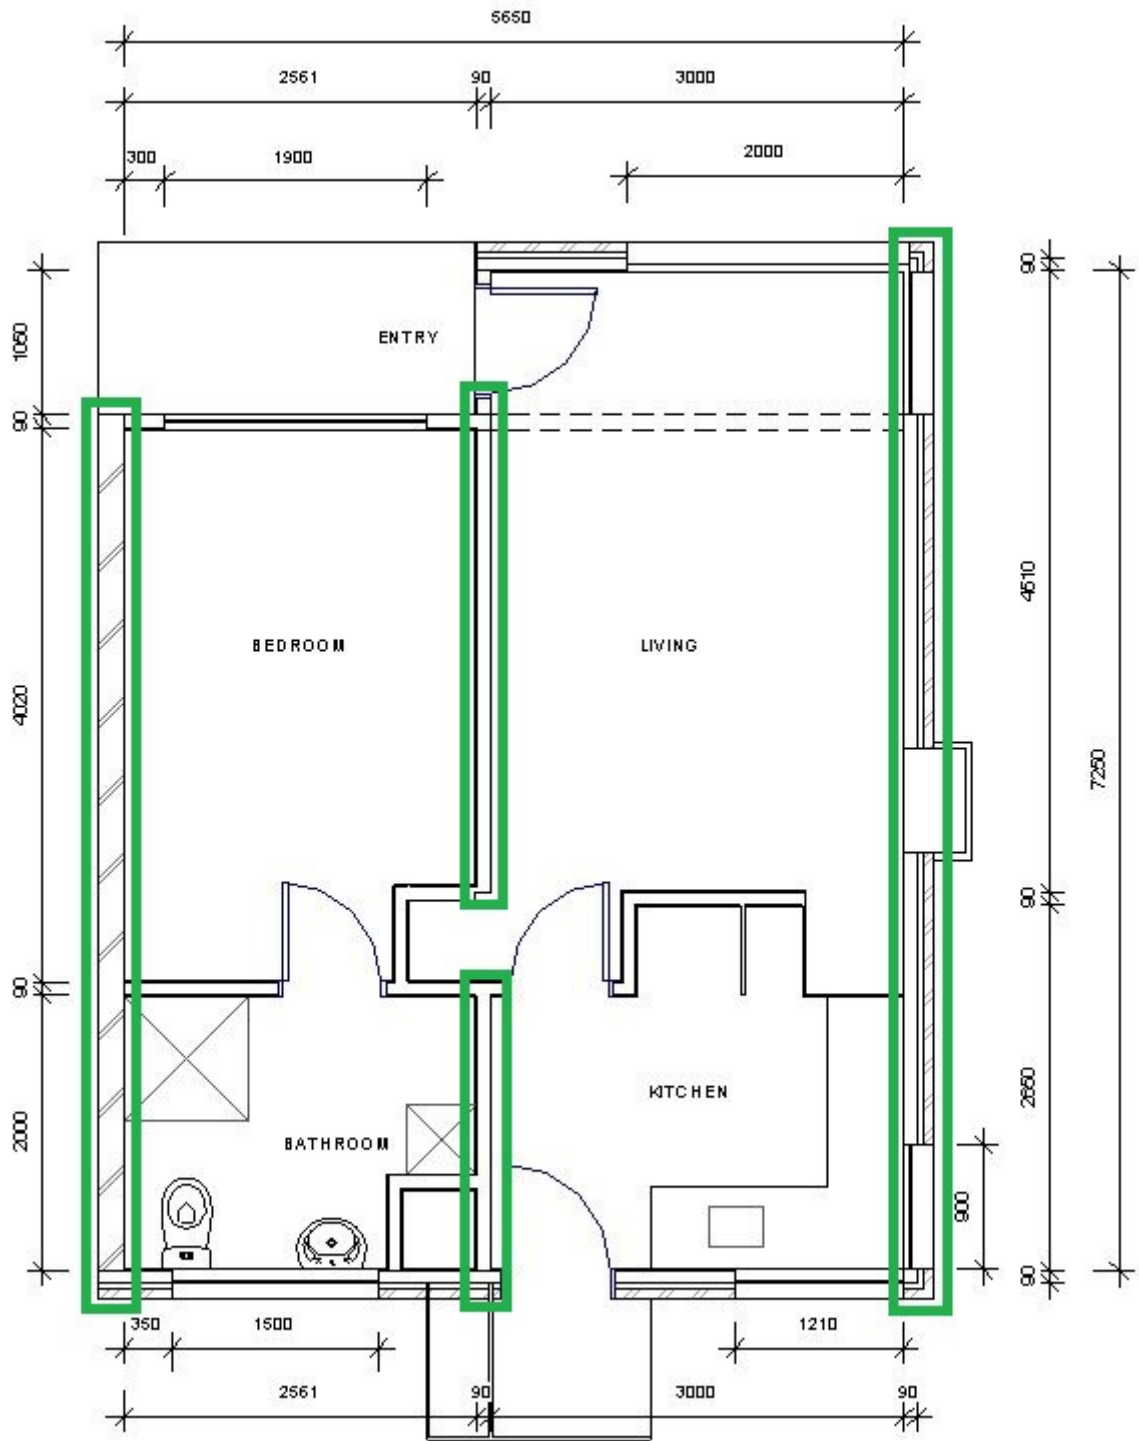


Figure 7: Walls used for bracing in the transverse direction.

### 6.3 Limitations and Assumptions in Results

The observed level of damage suffered by the buildings was deemed low enough to not affect their capacity. Therefore the analysis and assessment of the buildings was based on them being in an undamaged state. There may have been damage to the buildings that was unable to be observed that could cause the capacity of the buildings to be reduced; therefore the current capacity of the buildings may be lower than that stated.

The results have been reported as a %NBS and the stated value is that obtained from our analysis and assessment. Despite the use of best national and international practice in this analysis and assessment, this value contains uncertainty due to the many assumptions and simplifications which are made during the assessment. These include:

- Simplifications made in the analysis, including boundary conditions such as foundation fixity.
- Assessments of material strengths based on limited drawings, specifications and site inspections.
- The normal variation in material properties which change from batch to batch.
- Approximations made in the assessment of the capacity of each element, especially when considering the post-yield behaviour.
- Construction is consistent with normal practise of the era in which constructed.

### 6.4 Assessment

A summary of the structural performance of the buildings is shown in Table 3. Note that the values given represent the worst performing elements in the building, where these effectively define the building's capacity. Other elements within the building may have significantly greater capacity when compared with the governing elements.

**Table 3: Summary of Seismic Performance**

<b>Building Description</b>	<b>Critical element</b>	<b>% NBS based on calculated capacity in longitudinal direction</b>	<b>% NBS based on calculated capacity in transverse direction.</b>
Blocks A – D (Residential Units)	Timber bracing in the longitudinal direction	55%	100%
Block E (Garages)	Blockwork walls-	100%	100%

## 7 Geotechnical Summary

CERA indicates that Reg Adams Courts is located in a TC2 zone (as shown in Figure 8). This classification suggests future significant earthquakes will cause minor to moderate land damage due to liquefaction and settlement.

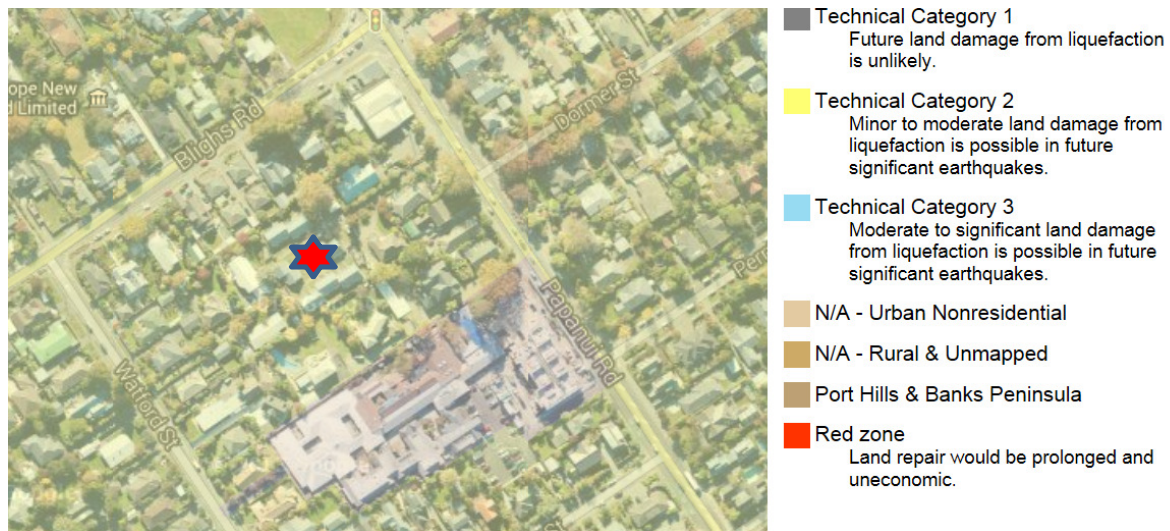


Figure 8: CERA Technical Categories map (loc. starred).

There is no evidence to suggest that further geotechnical investigation is warranted for this site.

## 8 Conclusions

- None of the buildings on site are considered to be Earthquake Prone.
- The residential units (Blocks A – D) have capacities of 53% NBS, as limited by the in-plane capacity of the bracing walls. They are deemed to be a ‘moderate risk’ in a design seismic event according to NZSEE guidelines. Their level of risk is 5-10 times that of a 100% NBS building (Figure 1).
- The garages (Block E) have a capacity of 100% NBS, as limited by the in-plane capacity of the bracing walls. They are deemed to be a ‘low risk’ in a design seismic event according to NZSEE guidelines. Their level of risk is less than 1 times that of a 100% NBS building (Figure 1).
- Based on the geotechnical appraisal, differential settlement as a result of liquefaction could result in further damage, similar in nature to that which has occurred in the recent earthquake sequence. However, based on the nature of construction, this is unlikely to result in the collapse of concrete ground beams beneath the masonry walls.

## 9 Recommendations

It is recommended that;

- Veneer at height (gable ends) have the veneer ties checked.
- Repair render on the foundation.
- Cosmetic repairs be undertaken as required.
- Strengthening schemes be developed to increase the seismic capacity of Blocks A - D to at least 67%NBS.

## 10 Limitations

- This report is based on an inspection of the buildings and focuses on the structural damage resulting from the Canterbury Earthquake sequence since September 2010. Some non-structural damage may be described but this is not intended to be a complete list of damage to non-structural items.
- Our professional services are performed using a degree of care and skill normally exercised, under similar circumstances, by reputable consultants practicing in this field at this time.
- This report is prepared for the Christchurch City Council to assist in the assessment of any remedial works required for the Reg Adams Courts Housing Complex. It is not intended for any other party or purpose.




## 11 References

- [1] NZS 1170.5: 2004, Structural design actions, Part 5 Earthquake actions, Standards New Zealand.
- [2] NZSEE (2006), Assessment and improvement of the structural performance of buildings in earthquakes, New Zealand Society for Earthquake Engineering.
- [3] Engineering Advisory Group, Guidance on Detailed Engineering Evaluation of Earthquake Affected Non-residential Buildings in Canterbury, Part 2 Evaluation Procedure, Draft Prepared by the Engineering Advisory Group, Revision 5, 19 July 2011.
- [4] Engineering Advisory Group, *Guidance on Detailed Engineering Evaluation of Non-residential buildings, Part 3 Technical Guidance*, Draft Prepared by the Engineering Advisory Group, 13 December 2011.
- [5] SESOC (2011), Practice Note – Design of Conventional Structural Systems Following Canterbury Earthquakes, Structural Engineering Society of New Zealand, 21 December 2011.
- [6] MBIE (2012), Repairing and rebuilding houses affected by the Canterbury earthquakes, Ministry of Building, Innovation and Employment, December 2012.

## **Appendix A – Photographs**



**Reg Adams Courts Housing Complex – Detailed Engineering Evaluation**

Reg Adams Courts Housing Complex		
1.	Typical exterior elevation (back)	
2.	Typical exterior elevation (front)	
3.	Typical exterior elevation (side)	






<p>4.</p>	<p>Typical kitchen</p>	 A photograph of a typical kitchen. The kitchen features light-colored wooden cabinets, a white electric stove with four burners, a white microwave on the countertop, and a white refrigerator. A window is visible on the left side of the kitchen. A blue bucket is on the floor in the foreground.
<p>5.</p>	<p>Typical living room</p>	 A photograph of a typical living room. The room features a floral patterned sofa, a television on a stand, and a window with blinds. A red patterned rug is on the floor. The room is well-lit by natural light from the window.

6.	Typical bathroom	
7.	Typical bedroom	



**Reg Adams Courts Housing Complex – Detailed Engineering Evaluation**

<p>8.</p>	<p>Horizontal foundation cracking (all units, most severe in Units 9 and 10)</p>	 A photograph showing the exterior of a building. The wall is made of light-colored stucco. There is a window with a grey frame above the wall. Below the window, there is a horizontal crack in the stucco. The ground in front of the building is covered with green grass and some weeds.
<p>9.</p>	<p>Cracking to interior linings from beam (all units)</p>	 A photograph showing the interior of a room. A wooden beam is visible on the ceiling. The wall below the beam has a vertical crack. A window with white curtains is visible in the background.
<p>10.</p>	<p>Typical roof space</p>	 A photograph showing the interior of a roof space. There are wooden joists and rafters. A white pipe runs horizontally across the space. A grey pipe runs vertically. The floor is covered with pink insulation.

**Reg Adams Courts Housing Complex – Detailed Engineering Evaluation**

---

<p>11.</p>	<p>Garages exterior elevation (front)</p>	
<p>12.</p>	<p>Double car port</p>	

## **Appendix B – Methodology and Assumptions**

## Seismic Parameters

As per NZS 1170.5:

- $T < 0.4s$  (assumed)
- Soil: Category D
- $Z = 0.3$
- $R = 1.0$  (IL2, 50 year)
- $N(T,D) = 1.0$

For the analyses, a  $\mu$  of 2 was assumed for the residential units.

## Analysis Procedure

As the units are small and have a number of closely spaced walls in both directions, the fibrous plaster board ceilings are assumed to be capable of transferring loads to all walls. It was therefore assumed that a global method could be used to carry the forces down to ground level in each direction. Bracing capacities were found by assuming a certain kN/m rating for the walls along each line. Due to the relatively unknown nature of the walls, the kN/m rating was taken as 3 kN/m for all timber walls with an aspect ratio (height: length) of less than 2:1. This was scaled down to zero kN/m at an aspect ratio of 3.5:1 as per NZSEE guidelines. %NBS values were then found through the ratio of bracing demand to bracing capacity for all walls in each direction.

## Additional Assumptions

Further assumptions about the seismic performance of the buildings were:

- Foundations and foundation connections had adequate capacity to resist and transfer earthquake loads.
- Connections between all elements of the lateral load resisting systems are detailed to adequately transfer their loads sufficiently and are strong enough so as to not fail before the lateral load resisting elements.

## **Appendix C – CERA DEE Spreadsheet**

<b>Location</b>		Building Name: Reg Adams Courts Housing Complex	Unit No: Street	Reviewer: Mary Ann Halliday
Building Address: 445	Papanui Road	CPEng No: 67073	Company: Opus International Consultants Ltd.	Company project number: 6-OC394.00
Legal Description: Residential units		Company phone number: (03) 363 5400	Date of submission: 19-Feb-14	Inspection Date: 20/11/2013
GPS south: 43	Degrees Min Sec		Revision: 1	Is there a full report with this summary? yes
GPS east: 172				
Building Unique Identifier (CCC): PRO 0583 (Blocks A-D)				

<b>Site</b>	Site slope: flat	Max retaining height (m):
Soil type:		Soil Profile (if available):
Site Class (to NZS1170.5):		If Ground improvement on site, describe:
Proximity to waterway (m, if <100m): 12		Approx site elevation (m): 9.00
Proximity to cliff top (m, if < 100m):		
Proximity to cliff base (m, if <100m):		

<b>Building</b>	No. of storeys above ground: 1	single storey = 1	Ground floor elevation (Absolute) (m):
Ground floor split? no			Ground floor elevation above ground (m):
Storeys below ground: 0			if Foundation type is other, describe:
Foundation type: mat slab		height from ground to level of uppermost seismic mass (for IEP only) (m):	Date of design: 1976-1992
Building height (m):			
Floor footprint area (approx):			
Age of Building (years): 33			
Strengthening present? no		If so, when (year)?	And what load level (%g)?
Use (ground floor): multi-unit residential		Brief strengthening description:	
Use (upper floors):			
Use notes (if required):			
Importance level (to NZS1170.5): IL2			

<b>Gravity Structure</b>	Gravity System: load bearing walls	truss depth, purlin type and cladding
Roof: timber truss		slab thickness (mm)
Floors: concrete flat slab		type
Beams: timber		typical dimensions (mm x mm)
Columns: precast concrete		#N/A
Walls: load bearing concrete		

<b>Lateral load resisting structure</b>	Lateral system along: lightweight timber framed walls	<b>Note: Define along and across in detailed report!</b>	note typical wall length (m)
Ductility assumed, μ:			estimate or calculation?
Period along:	0.00		estimate or calculation?
Total deflection (ULS) (mm):			estimate or calculation?
maximum interstorey deflection (ULS) (mm):			
Lateral system across: lightweight timber framed walls			note typical wall length (m)
Ductility assumed, μ:			estimate or calculation?
Period across:	0.00		estimate or calculation?
Total deflection (ULS) (mm):			estimate or calculation?
maximum interstorey deflection (ULS) (mm):			

<b>Separations:</b>	north (mm):	leave blank if not relevant
	east (mm):	
	south (mm):	
	west (mm):	

<b>Non-structural elements</b>	Stairs:		describe
Wall cladding: exposed structure			describe
Roof Cladding: Metal			
Glazing: aluminium frames			
Ceilings: plaster, fixed			
Services(list):			

<b>Available documentation</b>	Architectural: full	original designer name/date: Duder Homes Ltd, 1979
Structural: full		original designer name/date: Warren R. Lewis, 1979
Mechanical: full		original designer name/date: Christchurch City Council, 1979
Electrical: none		original designer name/date:
Geotech report: none		original designer name/date:

<b>Damage Site:</b>	Site performance: good	Describe damage:
(refer DEE Table 4-2)	Settlement: none observed	notes (if applicable):
Differential settlement: none observed		notes (if applicable):
Liquefaction: none apparent		notes (if applicable):
Lateral Spread: none apparent		notes (if applicable):
Differential lateral spread: none apparent		notes (if applicable):
Ground cracks: 0-20mm/20m		notes (if applicable):
Damage to area: none apparent		notes (if applicable):

<b>Building:</b>	Current Placard Status: green	Describe how damage ratio arrived at:
Along	Damage ratio: 0%	
Describe (summary):		
Across	Damage ratio: 0%	
Describe (summary):		
Diaphragms	Damage?: no	Describe:
CSWs:	Damage?: no	Describe:
Pounding:	Damage?: no	Describe:
Non-structural:	Damage?: yes	Describe: minor cracking in interior wall linings around beam

<b>Recommendations</b>	Level of repair/strengthening required: minor non-structural	Describe:
Building Consent required: no		Describe:
Interim occupancy recommendations: full occupancy		Describe:
Along	Assessed %NBS before e'quakes: 53% ##### %NBS from IEP below	If IEP not used, please detail assessment methodology: Equivalent Static
	Assessed %NBS after e'quakes: 53%	
Across	Assessed %NBS before e'quakes: 100% ##### %NBS from IEP below	
	Assessed %NBS after e'quakes: 100%	



<b>Location</b>		Building Name: Reg Adams Courts Housing Complex	Reviewer: Mary Ann Halliday
Building Address: 445 Papanui Road	Unit No: Street	CPEng No: 67073	Company: Opus International Consultants Ltd.
Legal Description: Garges and carports		Company project number: 6-OC394.00	Company phone number: (03) 363 5400
GPS south: 43	Degrees Min Sec	Date of submission: 19-Feb-14	Inspection Date: 20/11/2013
GPS east: 172		Revision: 1	Is there a full report with this summary? yes
Building Unique Identifier (CCC): PRO 0583 (Block E)			

<b>Site</b>	Site slope: flat	Max retaining height (m):
Soil type:		Soil Profile (if available):
Site Class (to NZS1170.5):		If Ground improvement on site, describe:
Proximity to waterway (m, if <100m): 12		Approx site elevation (m): 9.00
Proximity to cliff top (m, if < 100m):		
Proximity to cliff base (m, if <100m):		

<b>Building</b>	No. of storeys above ground: 1	single storey = 1	Ground floor elevation (Absolute) (m):
Ground floor split? no			Ground floor elevation above ground (m):
Storeys below ground: 0			if Foundation type is other, describe:
Foundation type: mat slab		height from ground to level of uppermost seismic mass (for IEP only) (m):	Date of design: 1976-1992
Building height (m):			
Floor footprint area (approx):			
Age of Building (years): 33			
Strengthening present? no		If so, when (year)?	And what load level (%g)?
Use (ground floor): parking		Brief strengthening description:	
Use (upper floors):			
Use notes (if required):			
Importance level (to NZS1170.5): IL2			

<b>Gravity Structure</b>	Gravity System: load bearing walls	rafter type, purlin type and cladding
Roof: timber framed		slab thickness (mm)
Floors: concrete flat slab		type
Beams: timber		typical dimensions (mm x mm)
Columns: precast concrete		#N/A
Walls: load bearing concrete		

<b>Lateral load resisting structure</b>	Lateral system along: concrete shear wall	<b>Note: Define along and across in detailed report!</b>	enter wall data in "IEP period calcs" worksheet for period calculation estimate or calculation?
Ductility assumed, μ:		##### enter height above at H31	estimate or calculation?
Period along:			estimate or calculation?
Total deflection (ULS) (mm):			
maximum interstorey deflection (ULS) (mm):			
Lateral system across: concrete shear wall		enter wall data in "IEP period calcs" worksheet for period calculation estimate or calculation?	estimate or calculation?
Ductility assumed, μ:		##### enter height above at H31	estimate or calculation?
Period across:			estimate or calculation?
Total deflection (ULS) (mm):			
maximum interstorey deflection (ULS) (mm):			

<b>Separations:</b>	north (mm):	leave blank if not relevant
	east (mm):	
	south (mm):	
	west (mm):	

<b>Non-structural elements</b>	Stairs:	describe
Wall cladding: exposed structure		describe
Roof Cladding: Metal		
Glazing: none		
Ceilings: none		
Services(list):		

<b>Available documentation</b>	Architectural: partial	original designer name/date: Duder Homes Ltd., 1979
Structural: full		original designer name/date: Warren R. Lewis, 1979
Mechanical: none		original designer name/date:
Electrical: none		original designer name/date:
Geotech report: none		original designer name/date:

<b>Damage Site:</b>	Site performance: good	Describe damage:
(refer DEE Table 4-2)	Settlement: none observed	notes (if applicable):
Differential settlement: none observed		notes (if applicable):
Liquefaction: none apparent		notes (if applicable):
Lateral Spread: none apparent		notes (if applicable):
Differential lateral spread: none apparent		notes (if applicable):
Ground cracks: 0-20mm/20m		notes (if applicable):
Damage to area: none apparent		notes (if applicable):

<b>Building:</b>	Current Placard Status: green	Describe how damage ratio arrived at:
Along	Damage ratio: 0%	
Describe (summary):		
Across	Damage ratio: 0%	
Describe (summary):		
Diaphragms	Damage?: no	Describe:
CSWs:	Damage?: no	Describe:
Pounding:	Damage?: no	Describe:
Non-structural:	Damage?: yes	Describe: minor cracking in interior wall linings around beam

<b>Recommendations</b>	Level of repair/strengthening required: none	Describe:
Building Consent required: no		Describe:
Interim occupancy recommendations: full occupancy		Describe:
Along	Assessed %NBS before e'quakes: 100% ##### %NBS from IEP below	If IEP not used, please detail assessment methodology: Equivalent Static
	Assessed %NBS after e'quakes: 100%	
Across	Assessed %NBS before e'quakes: 100% ##### %NBS from IEP below	
	Assessed %NBS after e'quakes: 100%	



**Opus International Consultants Ltd**  
20 Moorhouse Avenue  
PO Box 1482, Christchurch Mail Centre,  
Christchurch 8140  
New Zealand

t: +64 3 363 5400  
f: +64 3 365 7858  
w: [www.opus.co.nz](http://www.opus.co.nz)