



Burwood Play Centre
Qualitative Engineering Evaluation

Reference: 227679
Prepared for:
Christchurch City Council

Functional Location ID: BU 0719 001 EQ2

Revision: 3

Address: 241 New Brighton Road

Date: 23 January 2013

Document Control Record

Document prepared by:

Level 2, 518 Colombo Street
Christchurch 8011
PO Box 1061
Christchurch 8140
New Zealand

T +64 3 375 0761
F +64 3 379 6955
E christchurch@aurecongroup.com
W aurecongroup.com

A person using Aurecon documents or data accepts the risk of:

- Using the documents or data in electronic form without requesting and checking them for accuracy against the original hard copy version.
- Using the documents or data for any purpose not agreed to in writing by Aurecon.

Document control		aurecon				
Report Title		Qualitative Engineering Evaluation				
Functional Location ID		BU 0719 001 EQ2	Project Number		227679	
File Path		P:\ 227679 - Burwood Play Centre.docx				
Client		Christchurch City Council	Client Contact		Michael Sheffield	
Rev	Date	Revision Details/Status	Prepared	Author	Verifier	Approver
1	31 January 2012	Draft	S. Manning	S.Manning	F.Lanning	F.Lanning
2	21 June 2012	Draft	S. Manning	S. Manning	F.Lanning	F.Lanning
3	23 January 2013	Final	L.Castillo	L.Castillo	F.Lanning	F.Lanning
Current Revision		3				

Approval			
Author Signature		Approver Signature	
Name	Luis Castillo	Name	Forrest Lanning
Title	Senior Structural Engineer	Title	Senior Structural Engineer



Contents

Executive Summary	2
1 Introduction	3
1.1 General	3
2 Description of the Building	3
2.1 Building Age and Configuration	3
2.2 Building Structural Systems Vertical and Horizontal	3
2.3 Reference Building Type	3
2.4 Building Foundation System and Soil Conditions	4
2.5 Available Structural Documentation and Inspection Priorities	4
3 Structural Investigation	4
3.1 Summary of Building Damage	4
3.2 Record of Intrusive Investigation	4
3.3 Damage Discussion	4
4 Building Review Summary	5
4.1 Building Review Statement	5
4.2 Critical Structural Weaknesses	5
5 Building Strength (Refer to Appendix C for background information)	5
5.1 General	5
5.2 Initial %NBS Assessment	5
6 Conclusions and Recommendations	5
7 Explanatory Statement	6

Appendices

Appendix A Site Location, Photos and Levels Survey

Appendix B References

Appendix C Strength Assessment Explanation

Appendix D Background and Legal Framework

Appendix E Standard Reporting Spread Sheet

Executive Summary

This is a summary of the Qualitative Engineering Evaluation for the Burwood Play Centre building and is based on the Detailed Engineering Evaluation Procedure document issued by the Engineering Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

Building Details	Name	Burwood Play Centre			
Building Location ID	BU 0719 001 EQ2	Multiple Building Site	N		
Building Address	241 New Brighton Road	No. of residential units	0		
Soil Technical Category	TC3	Importance Level	2	Approximate Year Built	1970
Foot Print (m²)	200	Storeys above ground	1	Storeys below ground	0
Type of Construction	Steel frame roof, light timber framed walls with brick veneer.				
Qualitative L4 Report Results Summary					
Building Occupied	Y	The Burwood Play Centre is currently in use.			
Suitable for Continued Occupancy	Y	The Burwood Play Centre is suitable for continued use.			
Key Damage Summary	Y	Refer to summary of building damage Section 3.1 of the report body.			
Critical Structural Weaknesses (CSW)	N	No critical structural weaknesses were identified.			
Levels Survey Results	Y	Levels survey results are within acceptable limits. Although major liquefaction and differential settlement in surrounding area. Visible slope/cracking in concrete footpath in front of building.			
Building %NBS From Analysis	62%	Based on bracing calculations			
Qualitative L4 Report Recommendations					
Geotechnical Survey Required	Y	Building is in TC3 zone and is close to Red Zone - Moderate to significant land damage from liquefaction is possible in future significant earthquakes.			
Proceed to L5 Quantitative DEE	N	A quantitative DEE is not required for this structure.			
Approval					
Author Signature			Approver Signature		
Name	Luis Castillo		Name	Forrest Lanning	
Title	Senior Structural Engineer		Title	Senior Structural Engineer	



1 Introduction

1.1 General

On 13 January 2012 Aurecon engineers visited the Burwood Play Centre to carry out a qualitative building damage assessment on behalf of Christchurch City Council. Detailed visual inspections were carried out to assess the damage caused by the earthquakes on 4 September 2010, 22 February 2011, 13 June 2011, 23 December and related aftershocks.

The scope of work included:

- Assessment of the nature and extent of the building damage.
- Visual assessment of the building strength particularly with respect to safety of occupants if the building is currently occupied.
- Assessment of requirements if any for a detailed quantitative engineering evaluation including geotechnical investigation, level survey and any areas where linings and floor coverings need removal to expose structural damage.

This report outlines the results of our Qualitative Assessment of damage to the Burwood Play Centre at 241 New Brighton Road, Burwood and is based on the Detailed Engineering Evaluation Procedure document issued by the Structural Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

2 Description of the Building

2.1 Building Age and Configuration

Burwood play centre is an open plan, single storey, and slab on grade, steel frame style building. Light weight roofing is supported by steel truss beams. The beams span from steel columns that are embedded in the gypsum lined timber framed walls. The buildings footprint is approximately 200 square meters and is made up of a large play area and a toilet and kitchen. The building is considered an importance level 2 structure.

2.2 Building Structural Systems Vertical and Horizontal

Transverse lateral loads are resisted by light weight timber framed walls in both the longitudinal and transverse directions. The vertical load is carried by the steel truss beams and the steel columns. The structure is supported by concrete slab on grade foundation pads and strip footings.

2.3 Reference Building Type

The play centre is a single story steel frame timber wall type structure. This system appears to have performed well. The building has a unique design and is not generic.



2.4 Building Foundation System and Soil Conditions

Drawings indicate that the play centre slab and foundation pads may be constructed on a layer of compacted hard fill. Soil in this area is categorised as technical category 3 (TC3) blue meaning that there is a moderate to significant possibility of land damage from liquefaction in future significant earthquakes. As the building is located directly across the road from the Avon River there is the possibility of lateral spreading in the vicinity.

2.5 Available Structural Documentation and Inspection Priorities

Alteration building consent drawings dated 1997 were available for review and a drawing review was carried out. The main potential issues highlighted by the drawing review were the very open plan nature of the building and the presence of a lot of glazing around the building perimeter.

3 Structural Investigation

3.1 Summary of Building Damage

The Burwood Play Centre is currently in use but was not occupied at the time the damage assessment was carried out.

The steel beams and columns were visible from the exterior of the building. No obvious damage or residual deformation to the beam, column or connection was noticeable. Also inspected were the brick veneer walls. No damage to the brick veneer was observed. Evidence of differential settlement was visible in the surrounding area, the land is categorised as TC3 and the building is located directly across from the Avon River. This suggests that there could be damage to the foundation however there was no visible evidence of damage to the structure from differential settlement.

The main areas of damage that were noted are summarized as follows;

- Some evidence of settlement to footpath slabs at the eastern end of the building.
- Evidence of liquefaction including sink holes and local subsidence in surrounding land (not in immediate property).
- Significant differential settlement and lateral spreading is evident also in the surrounding area (not in immediate property).

3.2 Record of Intrusive Investigation

Most of the critical areas of the Burwood Play Centre primary structural elements were visible from the exterior of the building. Intrusive investigation of the structure was therefore not required at this stage.

3.3 Damage Discussion

Significant damage was not identified in the structure. Due to the category of the land (TC3) and the visible liquefaction and settlement in the area, damage or settlement to the foundation is possible.



4 Building Review Summary

4.1 Building Review Statement

Because most the critical structural components of this building were assessable each component type was able to be directly observed and reviewed. Only the foundations were not able to be directly reviewed. From the visible liquefaction and settlement in the area a level survey and geotechnical investigation was recommended.

4.2 Critical Structural Weaknesses

No critical structural weaknesses were identified as part of the qualitative assessment although the future of the building is dependent on the outcome of the geotechnical investigation.

5 Building Strength (Refer to Appendix C for background information)

5.1 General

The Burwood Play Centre is a symmetrical, single story, lightweight structure with simple and well defined load paths. This building appears to have performed well during the Canterbury Earthquakes to date. The major uncertainty relates to the performance and current soil conditions below the building. This structure has not been subject to a specific engineering design therefore an IEP is not an appropriate strength assessment procedure. A bracing check based on calculated demand from the building code will give the most reliable estimate of the %NBS. The building has a ductile failure mechanism in the transverse and longitudinal directions where timber framed walls resist lateral loads.

5.2 Initial %NBS Assessment

The building %NBS was calculated based on the length of lined timber walls in the longitudinal and transverse direction and compared to the demand. This gave a minimum %NBS of 62% in the critical direction. This value was obtained by using generic assessed values for strengths of existing materials and applying appropriate strength reduction factors.

6 Conclusions and Recommendations

The land below the Burwood Play Centre is zoned TC3 and as such has been identified as prone to significant liquefaction and settlement. Additionally there is evidence of settlement and liquefaction in the surrounding land. A level survey was carried out within the Burwood Play Centre to determine the extent of any differential settlement and the settlement was found to be acceptable.

It is also recommended that a geotechnical investigation is carried out to determine the precise nature of local ground conditions and the implications for future foundation performance.

The building is currently occupied and in use as a play centre and in our opinion it is considered suitable for continued occupation.



7 Explanatory Statement

The inspections of the building discussed in this report have been undertaken to assess structural earthquake damage. No analysis has been undertaken to assess the strength of the building or to determine whether or not it complies with the relevant building codes, except to the extent that Aurecon expressly indicates otherwise in the report. Aurecon has not made any assessment of structural stability or building safety in connection with future aftershocks or earthquakes – which have the potential to damage the building and to jeopardise the safety of those either inside or adjacent to the building, except to the extent that Aurecon expressly indicates otherwise in the report.

This report is necessarily limited by the restricted ability to carry out inspections due to potential structural instabilities/safety considerations, and the time available to carry out such inspections. The report does not address defects that are not reasonably discoverable on visual inspection, including defects in inaccessible places and latent defects. Where site inspections were made, they were restricted to external inspections and, where practicable, limited internal visual inspections.

To carry out the structural review, existing building drawings were obtained (where available) from the Christchurch City Council records. We have assumed that the building has been constructed in accordance with the drawings.

While this report may assist the client in assessing whether the building should be repaired, strengthened, or replaced that decision is the sole responsibility of the client.

This review has been prepared by Aurecon at the request of its client and is exclusively for the client's use. It is not possible to make a proper assessment of this review without a clear understanding of the terms of engagement under which it has been prepared, including the scope of the instructions and directions given to and the assumptions made by Aurecon. The report will not address issues which would need to be considered for another party if that party's particular circumstances, requirements and experience were known and, further, may make assumptions about matters of which a third party is not aware. No responsibility or liability to any third party is accepted for any loss or damage whatsoever arising out of the use of or reliance on this report by any third party.

Without limiting any of the above, Aurecon's liability, whether under the law of contract, tort, statute, equity or otherwise, is limited as set out in the terms of the engagement with the client.


Appendices



Appendix A

Site Location, Photos and Levels Survey

13 January 2012 – Burwood Play Centre Site Photographs

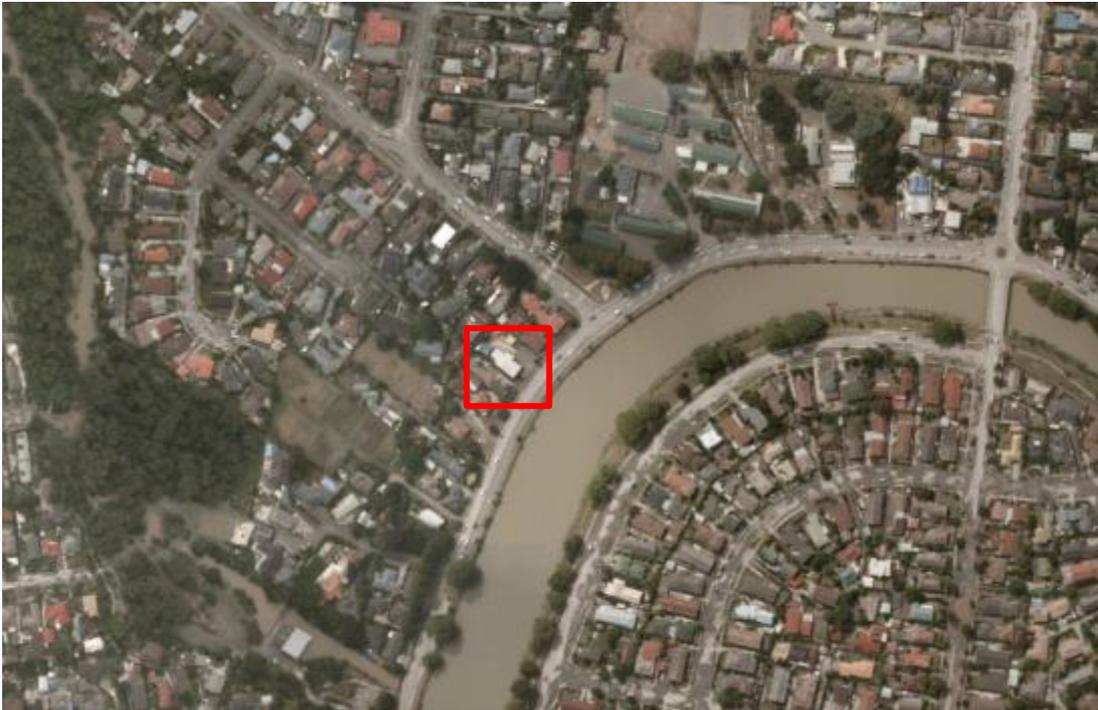

Aerial photo: Liquefaction is visible in the surrounding area.

Building North-East elevation.



Cracking in footpath.



Cracking in wall in front of play centre.



Cracking in pavement outside play centre




Steel truss beam spanning main room.



Masonry infill along eastern wall.



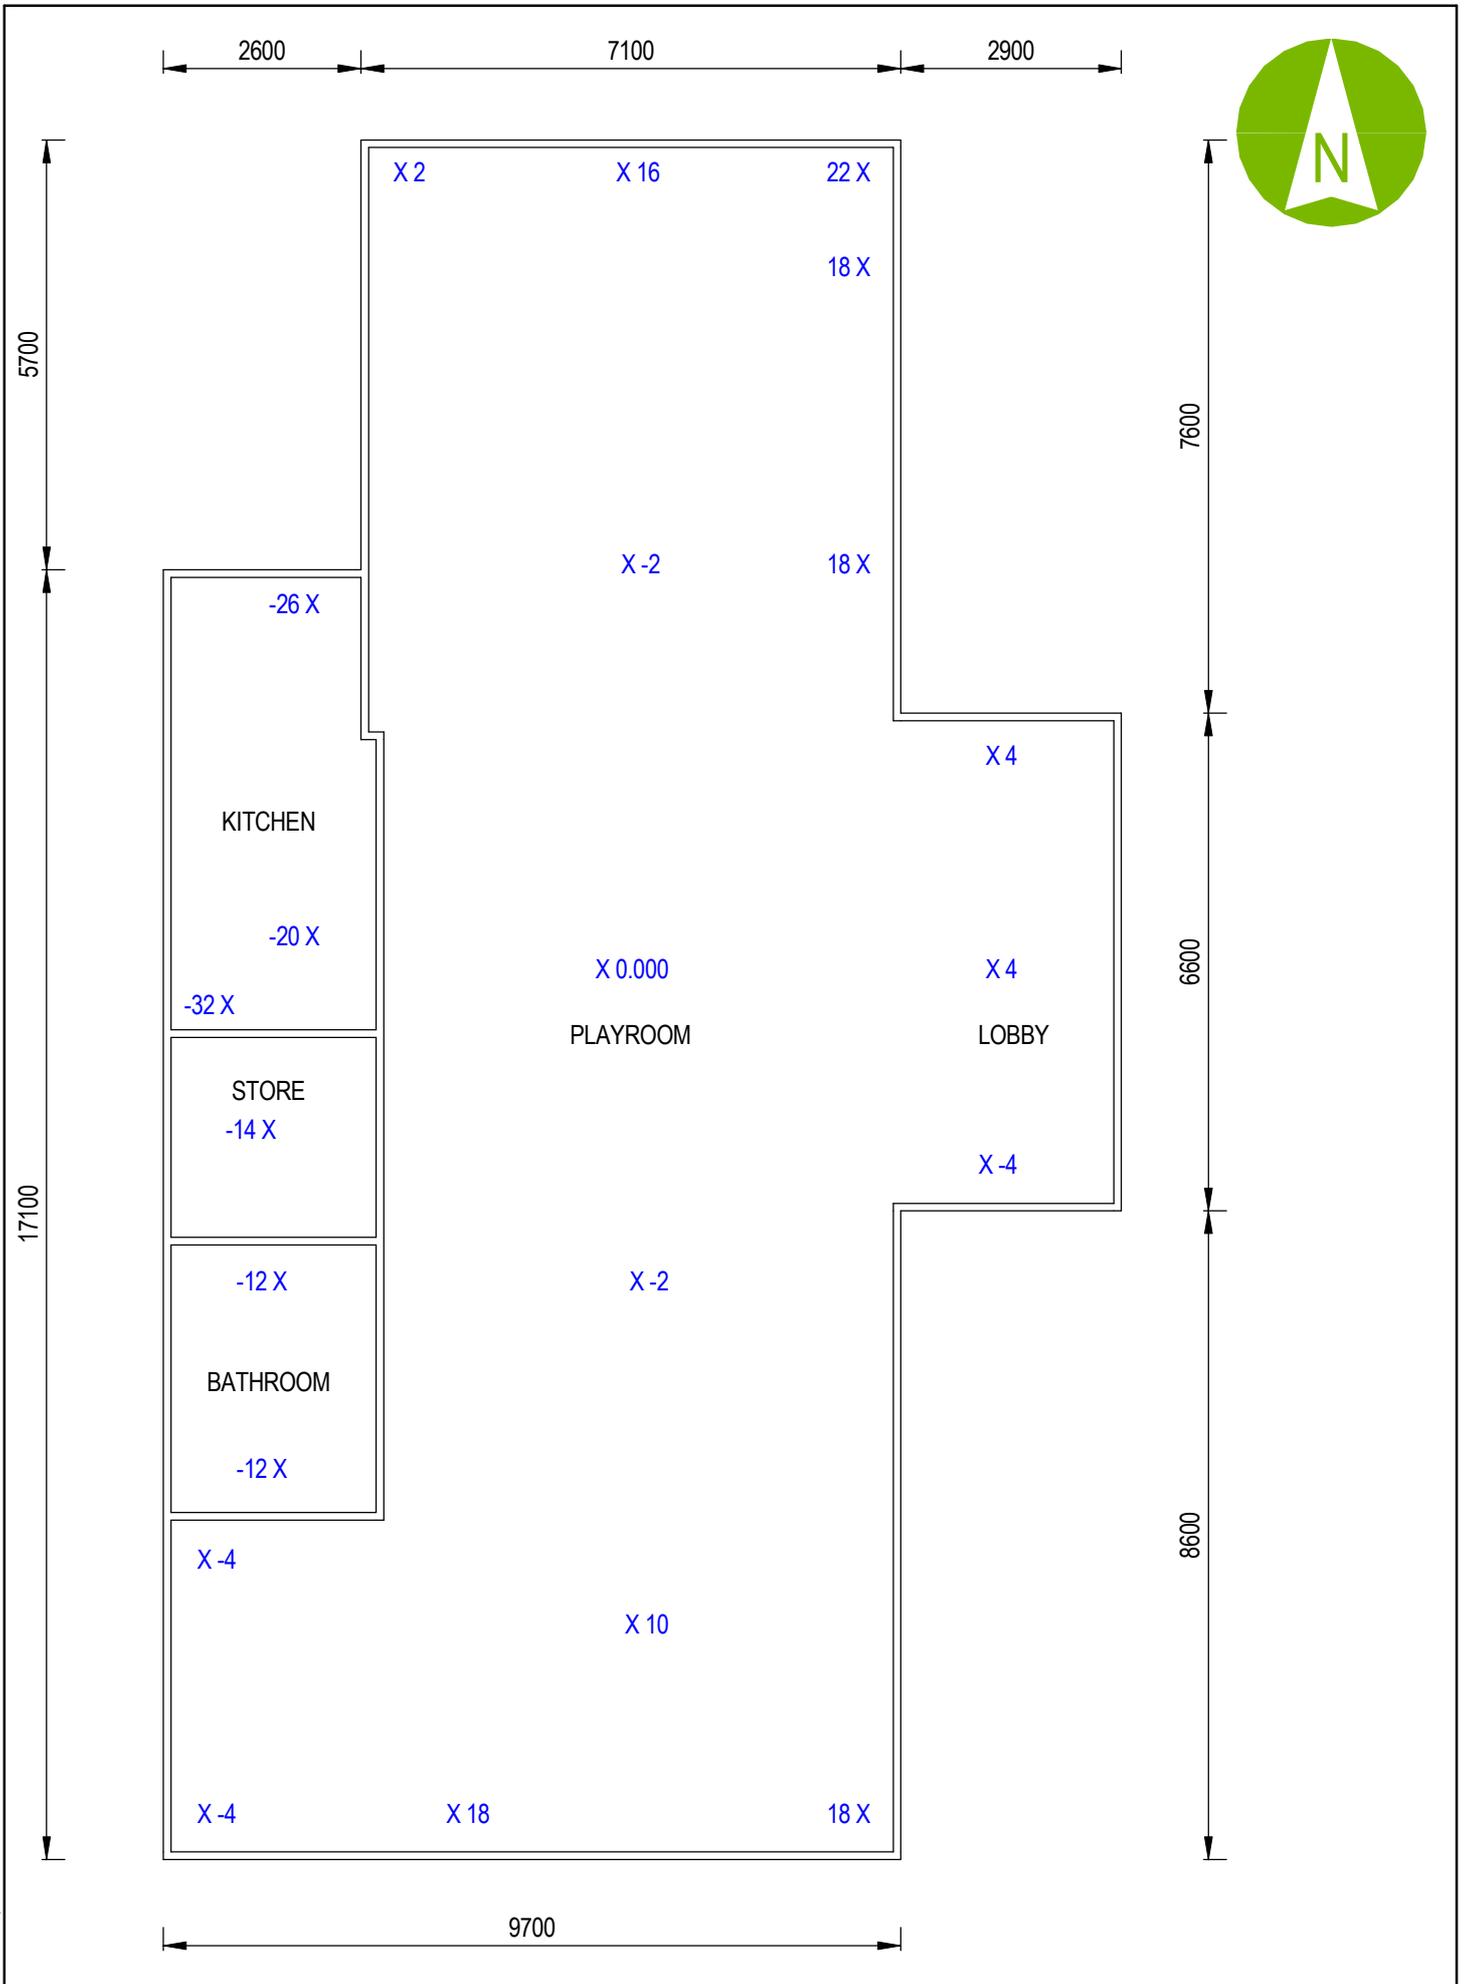

21/01/2013 4:04:51 pm



REV	DATE	REVISION DETAILS	APPROVAL

DRAWN	DESIGNED
D.HUNIA	C.BONG
CHECKED	
L.CASTILLO	
APPROVED	
	DATE
L.CASTILLO	

PROJECT	TITLE
BURWOOD PLAYCENTRE	LEVEL SURVEY

PRELIMINARY NOT FOR CONSTRUCTION	
PROJECT No. 227679	
SCALE 1:100	SIZE A4
DRAWING No. S-01-00	REV



Appendix B

References

1. Department of Building and Housing (DBH), "Revised Guidance on Repairing and Rebuilding Houses Affected by the Canterbury Earthquake Sequence", November 2011
2. New Zealand Society for Earthquake Engineering (NZSEE), "Assessment and Improvement of the Structural Performance of Buildings in Earthquakes", April 2012
3. Standards New Zealand, "AS/NZS 1170 Part 0, Structural Design Actions: General Principles", 2002
4. Standards New Zealand, "AS/NZS 1170 Part 1, Structural Design Actions: Permanent, imposed and other actions", 2002
5. Standards New Zealand, "NZS 1170 Part 5, Structural Design Actions: Earthquake Actions – New Zealand", 2004
6. Standards New Zealand, "NZS 3101 Part 1, The Design of Concrete Structures", 2006
7. Standards New Zealand, "NZS 3404 Part 1, Steel Structures Standard", 1997
8. Standards New Zealand, "NZS 3603, Timber Structures Standard", 1993
9. Standards New Zealand, "NZS 3604, Timber Framed Structures", 2011
10. Standards New Zealand, "NZS 4229, Concrete Masonry Buildings Not Requiring Specific Engineering Design", 1999
11. Standards New Zealand, "NZS 4230, Design of Reinforced Concrete Masonry Structures", 2004

Appendix C

Strength Assessment Explanation

New building standard (NBS)

New building standard (NBS) is the term used with reference to the earthquake standard that would apply to a new building of similar type and use if the building was designed to meet the latest design Codes of Practice. If the strength of a building is less than this level, then its strength is expressed as a percentage of NBS.

Earthquake Prone Buildings

A building can be considered to be earthquake prone if its strength is less than one third of the strength to which an equivalent new building would be designed, that is, less than 33%NBS (as defined by the New Zealand Building Act). If the building strength exceeds 33%NBS but is less than 67%NBS the building is considered at risk.

Christchurch City Council Earthquake Prone Building Policy 2010

The Christchurch City Council (CCC) already had in place an Earthquake Prone Building Policy (EPB Policy) requiring all earthquake-prone buildings to be strengthened within a timeframe varying from 15 to 30 years. The level to which the buildings were required to be strengthened was 33%NBS.

As a result of the 4 September 2010 Canterbury earthquake the CCC raised the level that a building was required to be strengthened to from 33% to 67% NBS but qualified this as a target level and noted that the actual strengthening level for each building will be determined in conjunction with the owners on a building-by-building basis. Factors that will be taken into account by the Council in determining the strengthening level include the cost of strengthening, the use to which the building is put, the level of danger posed by the building, and the extent of damage and repair involved.

Irrespective of strengthening level, the threshold level that triggers a requirement to strengthen is 33%NBS.

As part of any building consent application fire and disabled access provisions will need to be assessed.

Christchurch Seismicity

The level of seismicity within the current New Zealand loading code (AS/NZS 1170) is related to the seismic zone factor. The zone factor varies depending on the location of the building within NZ. Prior to the 22nd February 2011 earthquake the zone factor for Christchurch was 0.22. Following the earthquake the seismic zone factor (level of seismicity) in the Christchurch and surrounding areas has been increased to 0.3. This is a 36% increase.

For this assessment, the building's earthquake resistance is compared with the current New Zealand Building Code requirements for a new building constructed on the site. This is expressed as a percentage of new building standard (%NBS). The new building standard load requirements have been determined in accordance with the current earthquake loading standard (NZS 1170.5:2004 Structural design actions - Earthquake actions - New Zealand).

The likely capacity of this building has been derived in accordance with the New Zealand Society for Earthquake Engineering (NZSEE) guidelines 'Assessment and Improvement of the Structural Performance of Buildings in Earthquakes' (AISPBE), 2006. These guidelines provide an Initial Evaluation Procedure that assesses a buildings capacity based on a comparison of loading codes from when the building was designed

and currently. It is a quick high-level procedure that can be used when undertaking a Qualitative analysis of a building. The guidelines also provide guidance on calculating a modified Ultimate Limit State capacity of the building which is much more accurate and can be used when undertaking a Quantitative analysis.

The New Zealand Society for Earthquake Engineering has proposed a way for classifying earthquake risk for existing buildings in terms of %NBS and this is shown in Figure C1 below.

Description	Grade	Risk	%NBS	Existing Building Structural Performance	Improvement of Structural Performance	
					Legal Requirement	NZSEE Recommendation
Low Risk Building	A or B	Low	Above 67	Acceptable (improvement may be desirable)	The Building Act sets no required level of structural improvement (unless change in use) This is for each TA to decide. Improvement is not limited to 34%NBS.	100%NBS desirable. Improvement should achieve at least 67%NBS
Moderate Risk Building	B or C	Moderate	34 to 66	Acceptable legally. Improvement recommended		Not recommended. Acceptable only in exceptional circumstances
High Risk Building	D or E	High	33 or lower	Unacceptable (Improvement	Unacceptable	Unacceptable

Figure C1: NZSEE Risk Classifications Extracted from table 2.2 of the NZSEE 2006 AISPBE Guidelines

Table C1 below compares the percentage NBS to the relative risk of the building failing in a seismic event with a 10% probability of exceedance in 50 years (i.e. 0.2% in the next year). It is noted that the current seismic risk in Christchurch results in a 6% probability of exceedance in the next year.

Table C1: Relative Risk of Building Failure In A

Percentage of New Building Standard (%NBS)	Relative Risk (Approximate)
>100	<1 time
80-100	1-2 times
67-80	2-5 times
33-67	5-10 times
20-33	10-25 times
<20	>25 times

Appendix D

Background and Legal Framework

Background

Aurecon has been engaged by the Christchurch City Council (CCC) to undertake a detailed engineering evaluation of the building

This report is a Qualitative Assessment of the building structure, and is based on the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011.

A qualitative assessment involves inspections of the building and a desktop review of existing structural and geotechnical information, including existing drawings and calculations, if available.

The purpose of the assessment is to determine the likely building performance and damage patterns, to identify any potential critical structural weaknesses or collapse hazards, and to make an initial assessment of the likely building strength in terms of percentage of new building standard (%NBS).

Compliance

This section contains a brief summary of the requirements of the various statutes and authorities that control activities in relation to buildings in Christchurch at present.

Canterbury Earthquake Recovery Authority (CERA)

CERA was established on 28 March 2011 to take control of the recovery of Christchurch using powers established by the Canterbury Earthquake Recovery Act enacted on 18 April 2011. This act gives the Chief Executive Officer of CERA wide powers in relation to building safety, demolition and repair. Two relevant sections are:

Section 38 – Works

This section outlines a process in which the chief executive can give notice that a building is to be demolished and if the owner does not carry out the demolition, the chief executive can commission the demolition and recover the costs from the owner or by placing a charge on the owners' land.

Section 51 – Requiring Structural Survey

This section enables the chief executive to require a building owner, insurer or mortgagee carry out a full structural survey before the building is re-occupied.

We understand that CERA will require a detailed engineering evaluation to be carried out for all buildings (other than those exempt from the Earthquake Prone Building definition in the Building Act). It is anticipated that CERA will adopt the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011. This document sets out a methodology for both qualitative and quantitative assessments.

The qualitative assessment is a desk-top and site inspection assessment. It is based on a thorough visual inspection of the building coupled with a review of available documentation such as drawings and specifications. The quantitative assessment involves analytical calculation of the buildings strength and may require non-destructive or destructive material testing, geotechnical testing and intrusive investigation.

It is anticipated that factors determining the extent of evaluation and strengthening level required will include:

- The importance level and occupancy of the building
- The placard status and amount of damage
- The age and structural type of the building
- Consideration of any critical structural weaknesses
- The extent of any earthquake damage

Building Act

Several sections of the Building Act are relevant when considering structural requirements:

Section 112 – Alterations

This section requires that an existing building complies with the relevant sections of the Building Code to at least the extent that it did prior to any alteration. This effectively means that a building cannot be weakened as a result of an alteration (including partial demolition).

Section 115 – Change of Use

This section requires that the territorial authority (in this case Christchurch City Council (CCC)) be satisfied that the building with a new use complies with the relevant sections of the Building Code 'as near as is reasonably practicable'. Regarding seismic capacity 'as near as reasonably practicable' has previously been interpreted by CCC as achieving a minimum of 67%NBS however where practical achieving 100%NBS is desirable. The New Zealand Society for Earthquake Engineering (NZSEE) recommend a minimum of 67%NBS.

Section 121 – Dangerous Buildings

The definition of dangerous building in the Act was extended by the Canterbury Earthquake (Building Act) Order 2010, and it now defines a building as dangerous if:

- in the ordinary course of events (excluding the occurrence of an earthquake), the building is likely to cause injury or death or damage to other property; or
- in the event of fire, injury or death to any persons in the building or on other property is likely because of fire hazard or the occupancy of the building; or
- there is a risk that the building could collapse or otherwise cause injury or death as a result of earthquake shaking that is less than a 'moderate earthquake' (refer to Section 122 below); or
- there is a risk that that other property could collapse or otherwise cause injury or death; or
- a territorial authority has not been able to undertake an inspection to determine whether the building is dangerous.

Section 122 – Earthquake Prone Buildings

This section defines a building as earthquake prone if its ultimate capacity would be exceeded in a 'moderate earthquake' and it would be likely to collapse causing injury or death, or damage to other property. A moderate earthquake is defined by the building regulations as one that would generate ground shaking 33% of the shaking used to design an equivalent new building.

Section 124 – Powers of Territorial Authorities

This section gives the territorial authority the power to require strengthening work within specified timeframes or to close and prevent occupancy to any building defined as dangerous or earthquake prone.

Section 131 – Earthquake Prone Building Policy

This section requires the territorial authority to adopt a specific policy for earthquake prone, dangerous and insanitary buildings.

Christchurch City Council Policy

Christchurch City Council adopted their Earthquake Prone, Dangerous and Insanitary Building Policy in 2006. This policy was amended immediately following the Darfield Earthquake of the 4th September 2010.

The 2010 amendment includes the following:

- A process for identifying, categorising and prioritising Earthquake Prone Buildings, commencing on 1 July 2012;
- A strengthening target level of 67% of a new building for buildings that are Earthquake Prone;
- A timeframe of 15-30 years for Earthquake Prone Buildings to be strengthened; and,
- Repair works for buildings damaged by earthquakes will be required to comply with the above.

The council has stated their willingness to consider retrofit proposals on a case by case basis, considering the economic impact of such a retrofit.

We anticipate that any building with a capacity of less than 33%NBS (including consideration of critical structural weaknesses) will need to be strengthened to a target of 67%NBS of new building standard as recommended by the Policy.

If strengthening works are undertaken, a building consent will be required. A requirement of the consent will require upgrade of the building to comply 'as near as is reasonably practicable' with:

- The accessibility requirements of the Building Code.
- The fire requirements of the Building Code. This is likely to require a fire report to be submitted with the building consent application.

Building Code

The building code outlines performance standards for buildings and the Building Act requires that all new buildings comply with this code. Compliance Documents published by The Department of Building and Housing can be used to demonstrate compliance with the Building Code.

After the February Earthquake, on 19 May 2011, Compliance Document B1: Structure was amended to include increased seismic design requirements for Canterbury as follows:

- Hazard Factor increased from 0.22 to 0.3 (36% increase in the basic seismic design load)
- Serviceability Return Period Factor increased from 0.25 to 0.33 (80% increase in the serviceability design loads when combined with the Hazard Factor increase)

The increase in the above factors has resulted in a reduction in the level of compliance of an existing building relative to a new building despite the capacity of the existing building not changing.

Appendix E

Standard Reporting Spread Sheet

Detailed Engineering Evaluation Summary Data

V1.11

Location		Building Name: <input type="text" value="Burwood Playcentre"/>	Reviewer: <input type="text" value="Simon Manning"/>
Building Address: <input type="text"/>	Unit No: <input type="text" value="Street"/>	CPEng No: <input type="text" value="132053"/>	Company: <input type="text" value="Aurecon"/>
Legal Description: <input type="text"/>	<input type="text" value="241 New Brighton Road"/>	Company project number: <input type="text" value="227679"/>	Company phone number: <input type="text" value="(03) 3660821"/>
	Degrees Min Sec	Date of submission: <input type="text" value="21/02/2012"/>	Inspection Date: <input type="text" value="17/02/2012"/>
GPS south: <input type="text" value="43"/>	<input type="text" value="30"/> <input type="text" value="2.87"/>	Revision: <input type="text"/>	Is there a full report with this summary? <input type="text" value="yes"/>
GPS east: <input type="text" value="172"/>	<input type="text" value="41"/> <input type="text" value="0.95"/>		
Building Unique Identifier (CCC): <input type="text" value="BU 0719-001 EQ2"/>			

Site		Site slope: <input type="text" value="flat"/>	Max retaining height (m): <input type="text"/>
Soil type: <input type="text" value="mixed"/>	Site Class (to NZS1170.5): <input type="text" value="D"/>	Soil Profile (if available): <input type="text"/>	
Proximity to waterway (m, if <100m): <input type="text"/>	Proximity to cliff top (m, if < 100m): <input type="text"/>	Proximity to cliff base (m, if <100m): <input type="text"/>	If Ground improvement on site, describe: <input type="text"/>
		Approx site elevation (m): <input type="text" value="4.00"/>	

Building		No. of storeys above ground: <input type="text" value="1"/>	single storey = 1	Ground floor elevation (Absolute) (m): <input type="text" value="4.10"/>
Ground floor split?: <input type="text" value="no"/>	Foundation type: <input type="text" value="other (describe)"/>	Building height (m): <input type="text" value="3.00"/>	height from ground to level of uppermost seismic mass (for IEP only) (m): <input type="text" value="3"/>	Ground floor elevation above ground (m): <input type="text" value="0.10"/>
Stores below ground: <input type="text"/>	Age of Building (years): <input type="text"/>	Floor footprint area (approx): <input type="text" value="200"/>	Date of design: <input type="text" value="1965-1976"/>	if Foundation type is other, describe: <input type="text" value="Concrete Pad"/>
Strengthening present?: <input type="text" value="no"/>	Use (ground floor): <input type="text" value="educational"/>	Use (upper floors): <input type="text"/>	Use notes (if required): <input type="text" value="Playcentre - Educational"/>	Importance level (to NZS1170.5): <input type="text" value="IL2"/>
				Brief strengthening description: <input type="text"/>

Gravity Structure		Gravity System: <input type="text" value="frame system"/>	rafter type, purlin type and cladding: <input type="text" value="75 mm steel, steel, lightweight iron"/>
Roof: <input type="text" value="steel framed"/>	Floors: <input type="text" value="concrete flat slab"/>	Beams: <input type="text" value="steel non-composite"/>	slab thickness (mm): <input type="text"/>
Columns: <input type="text" value="structural steel"/>	Walls: <input type="text" value="load bearing brick"/>	beam and connector type: <input type="text" value="welded"/>	typical dimensions (mm x mm): <input type="text" value="75 x 75"/>
			#N/A

Lateral load resisting structure		Lateral system along: <input type="text" value="lightweight timber framed walls"/>	Note: Define along and across in detailed report! note typical wall length (m): <input type="text"/> estimate or calculation? <input type="text" value="estimated"/> estimate or calculation? <input type="text" value="estimated"/> estimate or calculation? <input type="text" value="estimated"/>
Ductility assumed, μ :	Period along:	0.00	
Total deflection (ULS) (mm):	maximum interstorey deflection (ULS) (mm):	<input type="text" value="3.00"/> <input type="text" value="0.40"/>	
		<input type="text" value="30"/> <input type="text" value="30"/>	
Lateral system across: <input type="text" value="lightweight timber framed walls"/>	Ductility assumed, μ :	Period across:	note typical wall length (m): <input type="text"/> estimate or calculation? <input type="text" value="estimated"/>
		<input type="text" value="3.00"/> <input type="text" value="0.40"/>	
		<input type="text" value="30"/> <input type="text" value="30"/>	

Total deflection (ULS) (mm):
 maximum interstorey deflection (ULS) (mm):

estimate or calculation?
 estimate or calculation?

Separations:

north (mm):
 east (mm):
 south (mm):
 west (mm): leave blank if not relevant

Non-structural elements

Stairs:
 Wall cladding: describe (note cavity if exists)
 Roof Cladding: describe
 Glazing:
 Ceilings:
 Services(list):

Available documentation

Architectural: original designer name/date:
 Structural: original designer name/date:
 Mechanical: original designer name/date:
 Electrical: original designer name/date:
 Geotech report: original designer name/date:

Damage

Site: Describe damage:
 (refer DEE Table 4-2) Site performance:
 Settlement: notes (if applicable):
 Differential settlement: notes (if applicable):
 Liquefaction: notes (if applicable):
 Lateral Spread: notes (if applicable):
 Differential lateral spread: notes (if applicable):
 Ground cracks: notes (if applicable):
 Damage to area: notes (if applicable):

Building:

Current Placard Status:
 Along Damage ratio: Describe how damage ratio arrived at:
 Describe (summary):
 Across Damage ratio: $Damage _ Ratio = \frac{(\% NBS (before) - \% NBS (after))}{\% NBS (before)}$
 Describe (summary):
 Diaphragms Damage?: Describe:
 CSWs: Damage?: Describe:
 Pounding: Damage?: Describe:
 Non-structural: Damage?: Describe:

Recommendations

Level of repair/strengthening required: Describe:
 Building Consent required: Describe:
 Interim occupancy recommendations: Describe:

Along	Assessed %NBS before:	<input type="text"/>	##### %NBS from IEP below	If IEP not used, please detail	<input type="text"/>
	Assessed %NBS after:	<input type="text"/>		assessment methodology:	
Across	Assessed %NBS before:	<input type="text"/>	##### %NBS from IEP below		
	Assessed %NBS after:	<input type="text"/>			

IEP Use of this method is not mandatory - more detailed analysis may give a different answer, which would take precedence. Do not fill in fields if not using IEP.

Period of design of building (from above): 1965-1976

h_n from above: 3m

Seismic Zone, if designed between 1965 and 1992:

not required for this age of building:
 not required for this age of building:

Period (from above):	along	across
(%NBS) _{nom} from Fig 3.3:	0.4	0.4

Note:1 for specifically design public buildings, to the code of the day: pre-1965 = 1.25; 1965-1976, Zone A =1.33; 1965-1976, Zone B = 1.2; all else 1.0
 Note 2: for RC buildings designed between 1976-1984, use 1.2
 Note 3: for buildings designed prior to 1935 use 0.8, except in Wellington (1.0)

Final (%NBS) _{nom} :	along	across
	0%	0%

2.2 Near Fault Scaling Factor

Near Fault scaling factor, from NZS1170.5, cl 3.1.6: 1.00

Near Fault scaling factor (1/N(T,D), Factor A):	along	across
	1	1

2.3 Hazard Scaling Factor

Hazard factor Z for site from AS1170.5, Table 3.3:
 Z₁₉₉₂, from NZS4203:1992:
 Hazard scaling factor, **Factor B**: #DIV/0!

2.4 Return Period Scaling Factor

Building Importance level (from above): 2
 Return Period Scaling factor from Table 3.1, **Factor C**:

2.5 Ductility Scaling Factor

Assessed ductility (less than max in Table 3.2):
 Ductility scaling factor: =1 from 1976 onwards; or =k_d, if pre-1976, from Table 3.3:

Ductility Scaling Factor, Factor D :	along	across
	0.00	0.00

2.6 Structural Performance Scaling Factor:

Sp:

Structural Performance Scaling Factor Factor E :	along	across
	#DIV/0!	#DIV/0!

2.7 Baseline %NBS, (NBS%)_b = (%NBS)_{nom} x A x B x C x D x E

%NBS _b :	along	across
	#DIV/0!	#DIV/0!

Global Critical Structural Weaknesses: (refer to NZSEE IEP Table 3.4)

3.1. Plan Irregularity, factor A: 1

3.2. Vertical irregularity, Factor B: 1

3.3. Short columns, Factor C: 1

Table for selection of D1	Severe	Significant	Insignificant/none
	Separation	0<sep<.005H	.005<sep<.01H

3.4. Pounding potential

Pounding effect D1, from Table to right
 Height Difference effect D2, from Table to right

Alignment of floors within 20% of H	0.7	0.8	1
Alignment of floors not within 20% of H	0.4	0.7	0.8

Therefore, Factor D:

3.5. Site Characteristics

Table for Selection of D2	Severe	Significant	Insignificant/none
Separation	0<sep<.005H	.005<sep<.01H	Sep>.01H
Height difference > 4 storeys	0.4	0.7	1
Height difference 2 to 4 storeys	0.7	0.9	1
Height difference < 2 storeys	1	1	1

3.6. Other factors, Factor F

For ≤ 3 storeys, max value =2.5, otherwise max value =1.5, no minimum
 Rationale for choice of F factor, if not 1

Along	Across
<input type="text"/>	<input type="text"/>

Detail Critical Structural Weaknesses: (refer to DEE Procedure section 6)

List any: Refer also section 6.3.1 of DEE for discussion of F factor modification for other critical structural weaknesses:

3.7. Overall Performance Achievement ratio (PAR)

<input type="text" value="0.00"/>	<input type="text" value="0.00"/>
-----------------------------------	-----------------------------------

4.3 PAR x (%NBS)b:

PAR x Baseline %NBS:

4.4 Percentage New Building Standard (%NBS), (before)



Aurecon New Zealand Limited
Level 2, 518 Colombo Street
Christchurch 8011

PO Box 1061
Christchurch 8140
New Zealand

T +64 3 375 0761

F +64 3 379 6955

E christchurch@aurecongroup.com

W aurecongroup.com

Aurecon offices are located in:
Angola, Australia, Botswana, China,
Ethiopia, Hong Kong, Indonesia,
Lesotho, Libya, Malawi, Mozambique,
Namibia, New Zealand, Nigeria,
Philippines, Singapore, South Africa,
Swaziland, Tanzania, Thailand, Uganda,
United Arab Emirates, Vietnam.